

Proposed Bridge Rehabilitation Programme 2021 Ballinloughane Bridge, Co. Limerick



NATURA IMPACT STATEMENT

Version: 19th March 2021



Tait Business Centre, Dominic Street,
Limerick City, Ireland.
t. +353 61 419477
f. +353 61 414315

e. info@ecofact.ie
w. www.ecofact.ie



EXECUTIVE SUMMARY

The current document provides the relevant information to allow the Competent Authority to undertake an Appropriate Assessment of the proposed rehabilitation works at Ballinloughane Bridge, Co. Limerick. A 'Screening for Appropriate Assessment' determined that significant impacts on the conservation objectives of the Lower River Shannon SAC were likely. The impacts identified were direct, indirect and cumulative water quality, invasive species and disturbance impacts. Mitigation to reduce or avoid these impacts are required and are set out here in this Natura Impact Statement. A letter from the Development Applications Unit of the Department of Tourism, Culture, Arts, Gaeltacht, Sport and Media was received by Punches Consulting on the 15th of March 2021, provided in Appendix 2. The letter outlined recommendations / observations for Nature Conservation and are summarised in the current report, in addition to a summary of how these comments are addressed by Ecofact for the proposed works at Ballinloughane Bridge.

Ballinloughane Bridge is located within the Lower River Shannon SAC. The proposed works mainly comprise replacing the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. It is unlikely that sea lamprey would be found at the site and they were not recorded here during previous surveys of the Galey downstream of Athea. River / Brook lamprey were also not recorded but suitable habitat is present and therefore the precautionary principle is applied here. Salmon are present downstream in the River Feale and may also use the Galey River at the site. Otters are considered likely to use the site for foraging and commuting. Impacts on these QIs, Sea lamprey, Brook lamprey, River lamprey, Salmon and Otter, were identified as water quality, disturbance and invasive species. Water quality impacts could arise from increased suspended solids, contaminants entering the watercourse, spillages of oils / fuels, cement / concrete and / or root herbicide. Dewatering of areas also poses risks to water quality. Disturbance may arise through increased noise and human activity on site. Invasive species could also be introduced on site through vectors such as machinery.

The mitigation measures include a Detailed Method Statement and CEMP following listed guidelines, limiting the footprint of the works, using silt fences and sandbags, the site compound not located within 5m of river and will be on dry land, access will be limited to a single route for instream works, impacts to riparian habitats will be minimised and with natural re-vegetation, timing of works outside lamprey and salmon spawning season, access maintained at all times under the bridge for Otter, any oiling / refuelling will be undertaken away from watercourse, oils / fuels will be in bunded tanks in site compound, machinery will be well maintained and checked for leaks, spill kits will be provided, security provided at site compound to deter vandalism, tool washing / grey water will be stored securely until removed off site, portaloos provided and regularly maintained by licensed facility, no vegetation debris allowed instream, silt fences on outside of works areas, sand bags placed inside works areas, works area fenced off, no concrete / cement mixing at river bank area, precast concrete used where possible, tarp or similar material placed underneath bridge to catch potential debris, no waste stored on site, the chosen ecologically safe herbicide will be named in the method statement and stored securely in site compound, site ecologist to agree 5 day weather window of low flow conditions ahead of instream works, for any pumping out water from dewatered area, silt bags will be installed at the end of pipes, NRA guidelines followed for biosecurity, sterilise all equipment / work gear that comes into contact with river, all equipment steam cleaned before arriving on site, site ecologist will be employed and will give site induction and oversee the set-up of dry works areas, any lamprey species potentially caught behind sand bags will be translocated upstream with section 14 licence by the site ecologist.

Mitigation measures proposed ensure that there are no residual impacts on the Lower River Shannon SAC. The potential impacts identified, including water quality, disturbance and invasive species, will be successfully reduced to imperceptible in scale following the implementation of the mitigation measures



in this NIS. It has therefore been concluded that following an examination, analysis and evaluation of the relevant information, including in particular the nature of the predicted impacts from the proposed works, and with the implementation of the mitigation measures proposed, that the proposed works do not pose a risk adversely affecting the integrity of any Natura 2000 site, either alone or in-combination with other plans or projects.



TABLE OF CONTENTS

1. INTRODUCTION	5
1.1 CONSULTATION	5
1.2 LEGISLATIVE CONTEXT	6
2. METHODOLOGY	9
2.1 DESKTOP REVIEW	9
2.2 SITE SURVEY	9
2.3 APPROPRIATE ASSESSMENT METHODOLOGY	9
2.3.1 <i>Natura Impact Assessment</i>	10
3. DESCRIPTION OF THE PROJECT	10
4. RECEIVING ENVIRONMENT	11
4.1 INTRODUCTION	11
4.2 GALEY CATCHMENT	11
4.2.1 <i>Lamprey Survey</i>	12
4.3 DESCRIPTION OF THE NATURA 2000 SITES AFFECTED	14
4.3.1 <i>Lower River Shannon SAC</i>	14
5. IMPACT ASSESSMENT	18
5.1 LOWER RIVER SHANNON SAC	18
5.1.1 <i>Annex II Species</i>	18
6. POTENTIAL FOR IN-COMBINATION EFFECTS	21
7. MITIGATION	22
7.1 DETAILED METHOD STATEMENT AND CEMP	22
7.2 AVOIDANCE	23
7.2.1 <i>Footprint of works</i>	23
7.2.2 <i>Timing of works</i>	23
7.3 WATER QUALITY PROTECTION	23
7.4 BIOSECURITY	24
7.5 SITE ECOLOGIST	25
8. RESIDUAL IMPACTS	25
9. CONCLUSION STATEMENT	29
REFERENCES	30
PLATES	32
APPENDIX 1 NPWS SITE SYNOPSIS	33
APPENDIX 2 DEVELOPMENT APPLICATIONS UNIT LETTER	39



1. INTRODUCTION

The current document provides the relevant information to allow the Competent Authority to undertake an Appropriate Assessment of the proposed rehabilitation works at Ballinloughane Bridge, Co. Limerick. A 'Screening for Appropriate Assessment' determined that significant impacts on the conservation objectives of the Lower River Shannon SAC were likely in the absence of mitigation measures. This report is included in Appendix 1 of the current report. The impacts identified were direct, indirect and cumulative water quality, invasive species and disturbance impacts. Mitigation to reduce or avoid these impacts are required and are set out here in this Natura Impact Statement.

The preparation of this NIS for Appropriate Assessment is as required under the Habitats Directive (92/43/EEC) in instances where a plan or project may give rise to significant effects upon a Natura 2000 site. Natura 2000 sites are of European Importance and have been designated in accordance with the requirements of the EC Habitats Directive (1992) and EC Birds Directive (2009/147/EC); transposed into Irish legislation as the European Communities (Birds and Natural Habitats) Regulations 2011 (S.I. 477 of 2011). The Habitats Directive, in combination with the Birds Directive (2009), establishes a network of internationally important sites designated for their ecological status; identified as Special Areas of Conservation (SACs) designated under the Habitats Directive for the protection of flora, fauna and habitats and as Special Protection Areas (SPAs) designated under the Birds Directive to protect rare, vulnerable and migratory birds. These sites together form a Europe-wide 'Natura 2000' network of designated sites, referred to in this report as Natura 2000 sites.

This assessment follows the Habitats Directive 92/43/EEC, Article 6(3) and the guidance published by the National Parks and Wildlife Service (DoEHLG, 2010) '*Appropriate Assessment of Plans and Projects in Ireland - Guidance for Planning Authorities*'. The current Natura Impact Statement (NIS) assesses the impact of the proposed remedial works at construction and operation stages in relation to direct, indirect and cumulative effects on the Integrity of the Natura 2000 network.

1.1 Consultation

The following statutory bodies provided information via publicly available sources for this report:

- National Parks and Wildlife Service (NPWS),
- Environmental Protection Agency (EPA),
- National Biodiversity Data Centre (NBDC).

A letter from the Development Applications Unit of the Department of Tourism, Culture, Arts, Gaeltacht, Sport and Media was received by Punches Consulting on the 15th of March 2021. This letter is provided in Appendix 2 of the current report. The letter outlined heritage-related observations / recommendations for the 2021 Bridge Rehabilitation Programme in Co. Limerick. The recommendations / observations for Nature Conservation are summarised below, in addition to a summary of how these comments are addressed by Ecofact for the proposed works at Ballinloughane Bridge.

The Development Applications Unit highlighted the need for the issue of invasive alien plant and animal species, as well as Crayfish plague, to be assessed and detail methods required to ensure such species and diseases are not accidentally introduced or spread during construction. Invasive species risk has been assessed in the current report and potential impacts noted. Mitigation for biosecurity has also been provided in section 7.4.



The potential for bats roosting in bridges, as well as derogation licence requirements for bats and the impacts and guidelines are highlighted in the letter from the DAU. A daytime bat inspection was carried out and is detailed in the 'Other Ecological Interests' section 7 of the Screening for Appropriate Assessment Report for Ballinloughane Bridge. No potential for bats was identified, the bridge was found to be generally unsuitable due to the flat and smooth structure. Furthermore, lighting is not included as part of the proposed bridge rehabilitation works at Ballinloughane.

Protected watercourse / wetland species are noted in the DAU letter, with specific reference to Otters, Salmon, lampreys, Freshwater Pearl Mussels, White-clawed Crayfish, Frogs, Newts, and Kingfishers. Furthermore, water quality, riparian habitat and consultations with IFI are specifically mentioned, as well as potential impacts on vascular, bryophyte and lichen species. Some of the above mentioned species are qualifying interests of the Lower River Shannon SAC and have been assessed in the current NIS. Other species not listed as Q.I.s were assessed in the 'Other Ecological Interests' section of the Screening for Appropriate Assessment Report. Specific mitigation has been provided for the protection of water quality, disturbance reduction and invasive species impacts in the current NIS. IFI have also been consulted by Punches Consulting for specific bridge sites in the 2021 rehabilitation programme. NRA Guidelines are specifically mentioned and only lime mortar should be used for repointing, grouting etc.

Finally, the letter from the DAU regarding Nature conservation notes the potential requirements for licenses where impacts on protected species and their habitats, resting or breeding places may occur. No works during the bird nesting season, as well as appropriate surveys and survey methodology are also noted in the letter, included in Appendix 2. As mentioned, section 7 of the Screening for Appropriate Assessment report details surveys and results for Other Ecological Interests. The recommendations for the species covered in the 'Other Ecological Interests' section of the Screening included no works in the bird nesting season and water quality protection measures. Based on the desk studies and surveys at the site, assessment of impacts in the current NIS and the Other Ecological Interests section of the Screening, no derogation licenses were deemed to be required for the proposed works at Ballinloughane bridge.

1.2 Legislative context

The current assessment takes account of Council Directive 92/43/EEC on the conservation of natural habitats and of wild fauna and flora - '*The Habitats Directive*' which was transposed into Irish law by the '*European Community (Natural Habitats) Regulations 1997*' (S.I. No. 94/1997). The most recent transposition of this legislation in Ireland is the European Communities (Birds and Natural Habitats) Regulations 2011 (S.I. No. 477 of 2011). The Birds Directive (2009/147/EC) which is now included in the former Regulations seeks to protect birds of special importance by the designation of Special Protection Areas (SPAs) whereas the Habitats Directive does the same for habitats and other species groups within Special Areas of Conservation (SACs), which are designated or proposed as candidate Special Areas of Conservation (cSACs). It is the responsibility of each member state to designate SPAs and SACs, both of which will form part of Natura 2000, a network of protected areas throughout the European Community. Article 6, paragraphs 3 and 4 of the EC 'Habitats' Directive (1992) state that:

6(3) *'Any plan or project not directly connected with or necessary to the management of the site but likely to have a significant effect thereon, either individually or in combination with other plans or projects, shall be subject to appropriate assessment of its implications for the site in view of the site's conservation objectives. In the light of the conclusions of the assessment of the implications for the site and subject to the provisions of paragraph 4, the competent national authorities shall agree to the plan*



or project only after having ascertained that it will not adversely affect the integrity of the site concerned and, if appropriate, after having obtained the opinion of the general public.'

6(4) *'If, in spite of a negative assessment of the implications for the site and in the absence of alternative solutions, a plan or project must nevertheless be carried out for imperative reasons of overriding public interest, including those of a social or economic nature, the Member State shall take all compensatory measures necessary to ensure that the overall coherence of Natura 2000 is protected. It shall inform the Commission of the compensatory measures adopted. Where the site concerned hosts a priority natural habitat type and / or a priority species, the only considerations which may be raised are those relating to human health or public safety, to beneficial consequences of primary importance for the environment or, further to an opinion from the Commission, to other imperative reasons of overriding public interest.'*

In addition, the European Court of Justice in Case C-127/02 (the "Waddenzee Ruling") has made a relevant ruling in relation to Appropriate Assessment and this is reflected in the current assessment:

'Any plan or project not directly connected with or necessary to the management of the site is to be subject to an appropriate assessment of its implications for the site in view of the site's conservation objectives if it cannot be excluded, on the basis of objective information, that it will have a significant effect on that site, either individually or in combination with other plans or projects' and that the plan or project may only be authorised "where no reasonable scientific doubt remains as to the absence of such effects.'

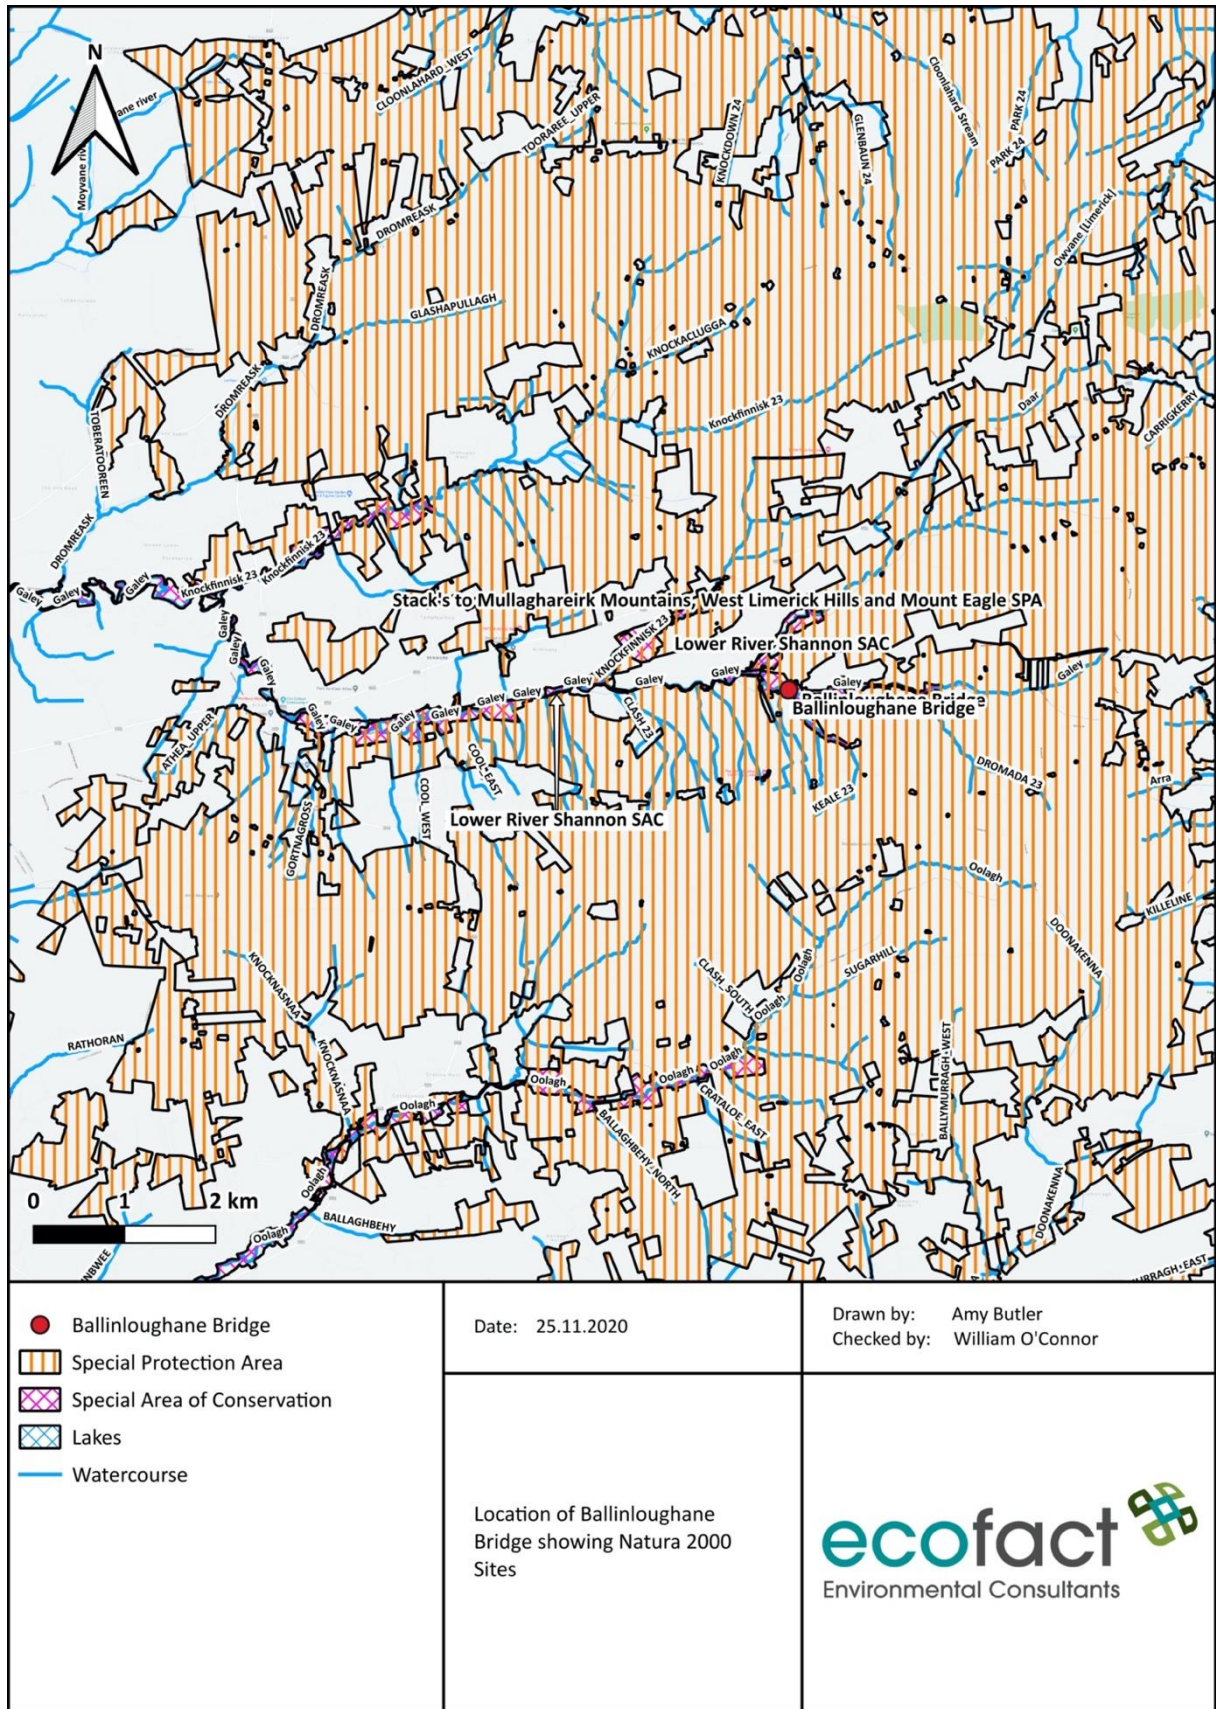


Figure 1 Location of Ballinloughane Bridge showing Natura 2000 Sites.



2. METHODOLOGY

2.1 Desktop Review

A desktop study was undertaken to identify the extent and scope of the potentially affected Natura 2000 sites within the current study area, in relation to the proposed rehabilitation works at Ballinloughane Bridge, including the Lower River Shannon SAC. The desktop study identified the conservation interests of the designated sites with respect to the qualifying interests (species and habitats) relevant to the designated sites within the area.

A review of published literature was undertaken in order to collate data on the receiving environment; a range of additional sources of information including scientific reports produced by, and information on the websites of the EPA and NPWS were also reviewed. Information sources reviewed included the NPWS site synopses for the Lower River Shannon SAC, as well as protected species data held on the NPWS online database. The National Biodiversity Data Centre website was accessed for previous records of protected species in the area. A full bibliography of information sources reviewed is given in the reference section.

2.2 Site Survey

The proposed development site was visited in March 2020. The existing bridge was surveyed via a walkover and any evidence of ecological features of high conservation concern such as those flora and fauna that occur in the closest Natura 2000 Sites were noted. Any ecological features such as non-native invasive species were also noted.

2.3 Appropriate Assessment Methodology

The preparation of this NIS for Appropriate Assessment follows the guidance published by DoEHLG (2010) '*Appropriate Assessment of Plans and Projects in Ireland. Guidance for Planning Authorities*'. According to these guidelines, assessing the impacts of a project or plan on a Natura 2000 site is a four staged approach, as described below:

- **Stage One: Screening / Test of Significance** - The process which identifies the likely impacts upon a Natura 2000 site of a project or plan, either alone or in combination with other projects or plans, and considers whether these impacts are likely to be significant;
- **Stage Two: Appropriate Assessment** - The consideration of the impact of the project or plan on the integrity of the Natura 2000 site, either alone or in combination with other projects or plans, with respect to the site's structure and function and its conservation objectives. Additionally, where there are adverse impacts, an assessment of the potential mitigation of those impacts.
- **Stage Three: Assessment of Alternative Solutions** - The process which examines alternative ways of achieving the objectives of the project or plan that avoid adverse impacts on the integrity of the Natura 2000 site; and
- **Stage Four: Assessment Where Adverse Impacts Remain** - An assessment of compensatory measures where, in the light of an assessment of Imperative Reasons of Overriding Public Interest (IROPI), it is deemed that the project or plan should proceed.

The safeguards set out in Article 6(3) and (4) of the Habitats Directive are triggered not by certainty but by the possibility of significant effects. Thus, in line with the precautionary principle, it is unacceptable



to fail to undertake an appropriate assessment on the basis that it is not certain that there are significant effects.

2.3.1 Natura Impact Assessment

A Natura Impact Statement (NIS) considers whether the plan or project, alone or in combination with other projects or plans, will have adverse effects on the integrity of a Natura 2000 site, and includes any mitigation measures necessary to avoid, reduce or offset negative effects. The current report is set out in the format of a NIS and comprises a scientific examination of the plan / project and the relevant Natura 2000 sites; to identify and characterize any possible implications for the site in view of the site's conservation objectives, structure and function, taking account of in combination effects. The requirements for Appropriate Assessment derive directly from Article 6(3) of the EU Habitats Directive (1992).

Direct and indirect impacts in isolation or in combination with other plans and projects on the identified Natura 2000 sites in view of the sites' conservation objectives have been examined. Case law of the European Court of Justice (ECJ) has established that Appropriate Assessment must be based on best scientific knowledge in the field. These are the qualifying interests i.e. Annex I habitats, Annex I bird species (EU Birds Directive, incorporated into the EU Habitats Directive) and Annex II species hosted by a site and for which that site has been selected. The conservation objectives for Natura sites (SACs and SPAs) are determined under Article 4 of the Habitats Directive and are intended to ensure that the relevant qualifying interests i.e. Annex I habitats, Annex I bird species and Annex II species present within the designated sites are maintained in a favourable condition. The current assessment of the proposed remedial works at Ballinloughane Bridge provides a description of the project and the receiving environment. The conservation objectives of the Natura 2000 site potentially affected by the proposed works are listed and potential impacts outlined with respect to the integrity of the Natura 2000 site. Mitigation measures have been proposed for the protection of the conservation interests and the avoidance of impacts to Natura 2000 Sites occurring within the study area.

3. DESCRIPTION OF THE PROJECT

Limerick City & County Council proposed to undertake rehabilitation works at several bridges as part of the Rehabilitation Programme for 2021. The proposed works at Ballinloughane Bridge is for the rehabilitation of an existing bridge which consists of a reinforced concrete and steel beam slab (jack-arch) supported on mass concrete abutment walls. The proposed works involves the removal of the bridge deck and its replacement with a precast concrete bridge beam and insitu concrete deck construction. The abutments will be retained in position and used to support new concrete bench seatings for the bridge beams.

The proposed works for Ballinloughane Bridge are summarised as follows (Punch Consulting Engineers, 2021):

- Existing traffic will be diverted away from the site.
- All vegetation including trees, shrubs and the like will be removed for 10 m upstream and downstream of the bridge over a width of 30 m approximately. All efforts will be made to preserve mature and semi-mature trees, where possible.
- The composite bridge deck, concrete slab and steel beams, will be removed. The top level of the abutments will be removed to a predetermined level and excavated behind to expose the natural rock bed. Mass concrete will be poured behind the abutment walls to form the bearing for the reinforced bench seatings.



- The precast concrete beams will be lowered into place on the bench seatings to form the core of the new bridge structure. A reinforced concrete deck will be poured above the beams. Reference shall be made to Inland Fisheries Ireland publication “Guidelines on Protection of Fisheries During Construction Works in and Adjacent to Waters”, to protect the quality of the river below.
- The width of the bridge will be increased to allow for widening of the road over and to offset the parapets beyond the edges of the carriageway.
- The remaining excavations will be backfilled with acceptable fill material to road formation level. The roadway will be reinstated using a surface course and binder (base), course of Dense Bitumen Macadam on a granular sub-base.
- Insitu reinforced concrete upstands for the parapet rails and raised plinths will be cast at the road edges on the bridge structure.
- Other ancillary items associated with the bridge construction include; proprietary galvanised steel parapets; road side drainage; traffic signs; etc.

4. RECEIVING ENVIRONMENT

4.1 Introduction

Figure 2 shows the location of the proposed bridge works. Ballinloughane Bridge is located south of Glengore town in Co. Limerick c. 5km east of Athea, over the 3rd order Galey River. The bridge site is surrounded by commercial non-native forestry plantations, scrub, wet grassland, improved agricultural grassland and bog habitats in the upper reaches of the catchment. The bridge is located over an unnamed road, with the R523 located c. 1.3km north of the bridge site. There are very few residential houses in the area, scattered around the landscape with some barns also present. In general, the main land use is forestry and agriculture.

Ballinloughane Bridge is located within both the Lower River Shannon SAC and the Stack’s to Mullaghareirk Mountains, West Limerick hills and Mount Eagle SPA. The Screening for Appropriate Assessment Report identified the potential for impacts on the Lower River Shannon SAC due to water quality, disturbance and invasive species impacts (Ecofact, 2020). No potential for impacts was identified on the SPA, as there is no suitable breeding habitat for Hen harrier in the immediate vicinity of the bridge. The works will not be directly affecting any foraging or breeding habitat for Hen harrier in the area (Ecofact, 2020).

4.2 Galey Catchment

The Galey River at the proposed rehabilitation works at Ballinloughane Bridge is a 3rd order watercourse (EPA Code: 23G01). The bridge is located just downstream of the confluence with a 1st order unnamed stream (EPA Code: 23_2614), and just upstream of the confluence with a 2nd order unnamed stream (EPA Code: 23_2472). The River Galey rises just c. 3.7rkm upstream of Ballinloughane Bridge, to the east. The River Galey is located in the Feale Catchment and is one of the main watercourses feeding into the catchment, being a 4th order watercourse before flowing into the Feale. The River Galey is designated as part of the Lower River Shannon SAC at the site.

There are no EPA Biological Water Quality Monitoring Stations upstream of Ballinloughane Bridge, but the nearest station downstream is located in Athea. This station was last monitored in 2005 and was given a rating of Q4 (EPA Station Code: 23G01 0100). The nearest station downstream of here was also rated as Q4 but in 2017 (EPA Station Code: 23G01 0200). Water quality in the River Galey declines south-west of Moyvane town, where there is a rating of Q3-4 in 2017 (EPA Station Code: 23G01 0400).



The furthest downstream station upstream of its confluence with the River Feale was rated as Q3 in 2017 (EPA Station Code: 23G01 0700). There are no monitoring stations on the River Feale downstream of the River Galey confluence. The River Galey flows for c. 36rkm north and west, with the lower reaches actually classified as a transitional waterbody, i.e. tidal. It joins the Feale estuary, and flows into the Shannon estuary following this. Arterial drainage works have been undertaken on the River Galey (O'Connor, 2006).

The Athea WwTP discharges into the River Galey c. 7.1rkm downstream of Ballinloughane Bridge. There is an Annual Environment Report for the plant which states that the population equivalent (p.e.) of the plant is 263 with an average hydraulic loading of 94 p.e. and a peak week collected load of 417 p.e (Irish Water, 2019). The AER also notes incidents such as uncontrolled releases of sewage and spillages, and that the WwTP discharge was not compliant with the ELVs in the discharge license based on the 2019 results (Irish Water, 2019). The AER also states that there is no observable impact on water quality (Irish Water, 2019). There are also numerous other WwTP discharges in the catchment, such as the WwTPs at Abbeyfeale and Listowel on the River Feale.

4.2.1 Lamprey Survey

O'Connor (2006) undertook a baseline survey of juvenile lamprey populations in the River Feale catchment, which included a total of 56 sites, sampled using semi-quantitative electrical fishing methods. Quantitative assessments were undertaken at an additional three sites. The report notes that it is thought that all three lamprey species occur in the Feale catchment, although juvenile river lampreys cannot be distinguished from brook lampreys. Lampreys were found to be present at 19 out of the 59 sites investigated (32.2%) and a total of n = 635 lampreys were recorded (O'Connor, 2006). The report notes that the River Galey has been subject to arterial drainage works which is likely to have affected lamprey populations. A total of 9 sites were investigated on the River Galey, up as far as Athea village. No lampreys were detected on any of the 9 sites. The report notes that the River Galey is a spate river and erosive floods may prevent lamprey nursery habitat was being created, as well as the impacts from the arterial drainage scheme. It is noted however that the sites fished on the River Galey were considered to have suitable habitat for juvenile lampreys, but none were found (O'Connor, 2006).

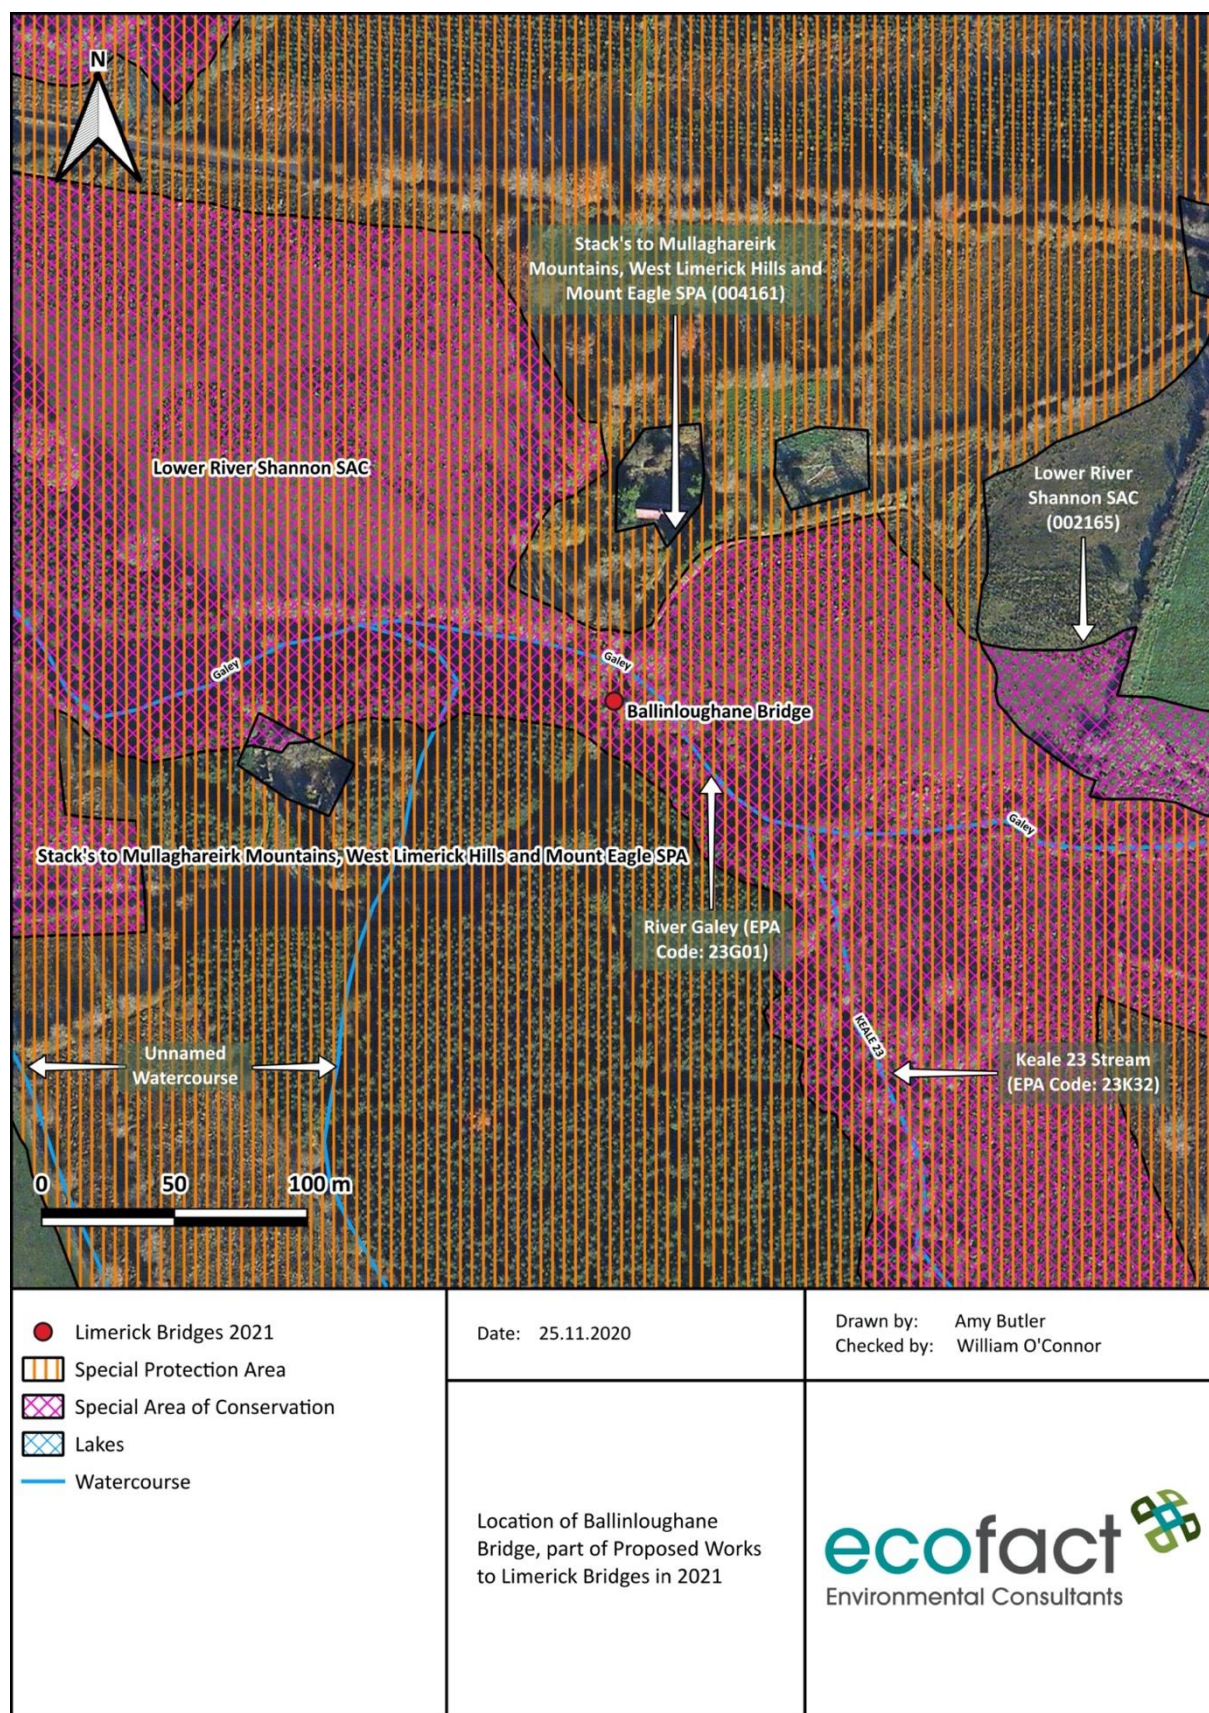


Figure 2 Location of Ballinloughane Bridge, part of Proposed Works to Limerick Bridges in 2021.



4.3 Description of the Natura 2000 Sites affected

4.3.1 Lower River Shannon SAC

Lower River Shannon SAC stretches from Killaloe, Co. Clare to Loop Head/Kerry head. It is designated for a wide range of habitats and species including Alluvial Forests, Molinia Meadows, Atlantic Salmon (*Salmo salar*) and Otter (*Lutra lutra*). The freshwater part of this SAC includes the main River Shannon channel and several tributaries. Molinia meadows dominated by rushes (*Juncus* spp.) and sedges (*Carex* spp.) with a high biodiversity of vegetation and important species like Blue-eyed Grass (*Sisyrinchium bermudiana*) and Pale Sedge (*C. pallescens*) are present. Alluvial woodlands are present around the University of Limerick. All three Irish Lamprey species occur in this SAC as do Twaites Shad (*Allosa fallax fallax*) and Salmon (*Salmo salar*). Other notable fish species include Smelt (*Osmerus eperlanus*) and Pollan (*Coregonus autumnalis pollan*). Much of the land has been improved or reclaimed and flood protection is common. Domestic and industrial waste in Limerick is an ongoing threat. In the Shannon estuary part of the SAC there are several species protected under Annex I of the E.U. Birds Directive.

4.3.1.1 Annex I Habitats

4.3.1.1.1 *Sandbanks which are slightly covered by seawater all the time*

This habitat is located over c. 65rkm downstream in the Shannon estuary according to the conservation objectives map 3 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.2 *Estuaries*

This habitat is present over c. 36rkm downstream of the bridge site and comprises the lower reaches of the River Galey where it transitions into an estuary in the SAC, according to the conservation objectives map 4 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.3 *Mudflats and sandflats not covered by seawater at low tide*

This habitat is present over c. 50rkm downstream of the bridge site in the Feale estuary in the SAC, according to the conservation objectives map 5 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.4 *Coastal Lagoons*

This habitat is located over c. 65rkm downstream in the Shannon estuary, according to the conservation objectives map 6 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.



4.3.1.1.5 *Large Shallow Inlets and Bays*

This habitat is located over c. 50rkm downstream in the Shannon estuary, according to the conservation objectives map 7 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.6 *Reefs*

This habitat is located over c. 55rkm downstream in the Shannon estuary, according to the conservation objectives map 8 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.7 *Perennial Vegetation of Stony Banks*

This terrestrial habitat is located at its closest point c. 33km west of the bridge site at Ballybunion, according to the conservation objectives map 10 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.8 *Vegetated sea cliffs of the Atlantic and Baltic Coasts*

This terrestrial habitat is located at its closest point c. 33km west of the bridge site at Ballybunion, according to the conservation objectives map 11 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.9 *Salicornia and other annuals colonising mud and sand*

This habitat is located over c. 65rkm downstream in the Shannon estuary, according to the conservation objectives map 12 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.10 *Atlantic salt meadows (Glauco-Puccinellietalia maritimae)*

This habitat is located over c. 50rkm downstream in the Feale estuary, according to the conservation objectives map 12 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.

4.3.1.1.11 *Mediterranean Salt Meadows (Juncetalia maritimi)*

This habitat is located over c. 50rkm downstream in the estuary, according to the conservation objectives map 12 for the SAC (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC due to distance.



4.3.1.1.12 *Water courses of plain to montane levels with the Ranunculus fluitantis and Callitriche-Batrachion vegetation*

The habitat in the SAC is mapped as being located in Limerick City and the Mague Estuary, according to the conservation objectives map 13 for the SAC (NPWS, 2012). There is no known record of this habitat downstream of the bridge site. The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC.

4.3.1.1.13 *Molinia meadows on calcareous, peaty or clayey-silt-laden soils (Molinion caeruleae)*

The full extent of this habitat in the SAC is unknown but this is a terrestrial habitat, and the proposed works will not affect the water table (NPWS, 2012). This habitat was not found to be present at the site or in the immediate surrounds. The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC.

4.3.1.1.14 *Alluvial forests with Alnus glutinosa and Fraxinus excelsior (Alno-Padion, Alnion incanae, Salicion albae)*

The terrestrial habitat in the SAC is mapped as being located in Castleconnell and along the Allaughan River near Tournafulla, according to the conservation objectives map 14 for the SAC (NPWS, 2012). This is located c. 11km south of the bridge site. The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this habitat in the SAC.

Table 1 Habitats listed as qualifying interests of the Lower River Shannon SAC.

Natura Code	Qualifying Interest	Occurrence in the study area
1110	Sandbanks which are slightly covered by seawater all the time	X
1130	Estuaries	X
1140	Mudflats and sandflats not covered by seawater at low tide	X
1150	Coastal Lagoons	X
1160	Large Shallow Inlets and Bays	X
1170	Reefs	X
1220	Perennial Vegetation of Stony Banks	X
1230	Vegetated sea cliffs of the Atlantic and Baltic Coasts	X
1310	Salicornia and other annuals colonising mud and sand	X
1330	Atlantic salt meadows (<i>Glauco-Puccinellietalia maritima</i>)	X
1410	Mediterranean Salt Meadows (<i>Juncetalia maritimi</i>)	X
3260	Water courses of plain to montane levels with the <i>Ranunculus fluitantis</i> and <i>Callitriche-Batrachion</i> vegetation	X
6410	<i>Molinia</i> meadows on calcareous, peaty or clayey-silt-laden soils (<i>Molinion caeruleae</i>)	X
91E0	Alluvial forests with <i>Alnus glutinosa</i> and <i>Fraxinus excelsior</i> (<i>Alno-Padion</i> , <i>Alnion incanae</i> , <i>Salicion albae</i>)	X

4.3.1.2 Annex II Species

4.3.1.2.1 *Freshwater Pearl Mussel*

This species is only located in the River Cloon within the Lower River Shannon SAC, according to the conservation objectives map 15 (NPWS, 2012). There is no known record of this species downstream



of the bridge site. The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this species in the SAC.

4.3.1.2.2 *Sea lamprey*

This species is present downstream in the River Feale (O'Connor, 2006), and was not found to be present in the River Galey, which was surveyed from downstream of Athea town. It is unlikely that this species would be found at the site but it cannot be ruled out. This species is present downstream of the bridge site. The Screening for Appropriate Assessment identified the potential for impacts on this species.

4.3.1.2.3 *Brook lamprey*

This species is present downstream in the River Feale (O'Connor, 2006), and although it was not found to be present in the River Galey, suitable habitat is present, and the precautionary principle will be applied. This species could be affected by impacts arising from the proposed rehabilitation works. The Screening for Appropriate Assessment identified the potential for impacts on this species.

4.3.1.2.4 *River lamprey*

This species is present downstream in the River Feale (O'Connor, 2006), and although it was not found to be present in the River Galey, suitable habitat is present, and the precautionary principle will be applied. This species could be affected by impacts arising from the proposed rehabilitation works. The Screening for Appropriate Assessment identified the potential for impacts on this species.

4.3.1.2.5 *Salmon*

This species is present downstream in the River Feale and may also use the Galey River at the site. Salmonid habitat is present here. This species could be affected by impacts arising from the proposed rehabilitation works. The Screening for Appropriate Assessment identified the potential for impacts on this species.

4.3.1.2.6 *Common Bottlenose Dolphin*

This species would be located over c. 50km in the Shannon estuary, according to the conservation objectives map 16 for the SAC (NPWS, 2012). This map shows that its critical habitat is located c. 60km downstream of the bridge site (NPWS, 2012). The Screening for Appropriate Assessment did not identify any potential pathway for impacts on this species in the SAC.

4.3.1.2.7 *Otter*

This species is considered likely to use the River Galey at the site for foraging and commuting. Salmonid habitat is present in this watercourse and would therefore be a good food source for Otter. The Screening for Appropriate Assessment identified the potential for impacts on this species.



Table 2 Species listed as qualifying interests of the Lower River Shannon SAC.

Natura Code	Qualifying Interest	Occurrence in the study area
1029	Freshwater Pearl Mussel	X
1096	Sea lamprey	✓
1096	Brook lamprey	✓
1099	River lamprey	✓
1106	Salmon	✓
1349	Common Bottlenose Dolphin	X
1355	Otter	✓

5. IMPACT ASSESSMENT

At NIS stage, mitigation to offset potential negative impacts can be provided. In addition, the impact of the project / plan affecting the integrity of a Natura 2000 site is considered with respect to the conservation objectives of the site. Integrity is defined as: 'the coherence of the site's ecological structure and function, across its whole area, or the habitats, complex of habitats and/or populations of species for which the site is or will be classified'. Therefore, the integrity of a site is principally related to the structure and function of the site with regard to its Annex I habitats and Annex II species listed as the qualifying interests. The conservation status of these qualifying interests comprises the primary conservation objectives for all designated Natura 2000 sites.

5.1 Lower River Shannon SAC

The affected qualifying interests of the Lower River Shannon SAC are presented in Table 3 below with the potential impacts of the proposed works on each and the type of mitigation measures required. The qualifying interests are discussed individually below in terms of the potential impacts that could arise from the proposed works.

Table 3 Potential impacts on the affected qualifying interests of the Lower River Shannon SAC arising from the proposed rehabilitation works at Ballinloughane Bridge.

	Natura Code	Qualifying Interest	Impacts
Annex II Species	1095	Sea lamprey	Water quality; invasive species
	1096	Brook lamprey	Water quality; disturbance; invasive species
	1099	River lamprey	Water quality; disturbance; invasive species
	1106	Salmon	Water quality; disturbance; invasive species
	1355	Otter	Water quality; disturbance; invasive species

5.1.1 Annex II Species

5.1.1.1 Sea lamprey

5.1.1.1.1 *Construction Phase*

Ballinloughane Bridge is located within the Lower River Shannon SAC. O'Connor (2006) found sea lampreys to be present in the River Feale, but no lampreys were recorded in the River Galey during this survey. Therefore, this species is unlikely to be present in the River Galey at the site. Nonetheless, this species is present downstream.



Sea lamprey could be affected by water quality impacts arising from the proposed rehabilitation works. Water quality issues could arise from an increase in suspended solids and / or contaminants in the watercourse which can be generated by the activities at the works site. Such as when raking out the mortar joints and removing debris. These can also come from accidental spillages of oil / fuel, cement / concrete and / or root herbicide that may be used for the bridge rehabilitation works. It is proposed to replace the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. There is a risk of concrete / cement spillages instream which can alter the pH of watercourses. This dewatering of areas also poses risks to water quality. In such situations there is also a risk of water quality impacts arising from the potential accidental release of sand into the river from sandbags used around dewatered areas in the event of a flood. Any water pollution will affect lampreys and habitats downstream.

Machinery and personnel working on site could also lead to the introduction of invasive species to the site. Invasive species can quickly take over an ecosystem and disrupt the balance of the system. Invasive species can also spread rapidly and could affect the habitats that Sea lampreys utilize downstream. In the absence of any biosecurity mitigation, this could be a significant impact.

5.1.1.1.2 Operational Phase

As the bridge is an existing bridge, there is no potential for operational phase impacts to arise as a result of the proposed rehabilitation works. There will be no change of use for the bridge site.

5.1.1.2 Brook lamprey

5.1.1.2.1 Construction Phase

Ballinloughane Bridge is located within the Lower River Shannon SAC. O'Connor (2006) found Brook / River lampreys to be present in the River Feale, but no lampreys were recorded in the River Galey during this survey. However, suitable habitat is present in the River Galey so the precautionary approach is taken. Nonetheless, this species is present downstream.

Brook lamprey, similarly to sea lamprey, could be affected by water quality impacts arising from the proposed rehabilitation works. Water quality issues could arise from an increase in suspended solids and / or contaminants in the watercourse which can be generated by the activities at the works site. Such as when raking out the mortar joints and removing debris. These can also come from accidental spillages of oil / fuel, cement / concrete and / or root herbicide that may be used for the bridge rehabilitation works. It is proposed to replace the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. There is a risk of concrete / cement spillages instream which can alter the pH of watercourses. Dewatering of areas also poses risks to water quality. In such situations there is also a risk of water quality impacts arising from the potential accidental release of sand into the river from sandbags used around dewatered areas in the event of a flood. Any water pollution will affect lampreys and habitats downstream. If present at the site, this species could also be affected by disturbance during instream works.

Machinery and personnel working on site could also lead to the introduction of invasive species to the site. Invasive species can quickly take over an ecosystem and disrupt the balance of the system. Invasive species can also spread rapidly and could affect the habitats that Brook lampreys utilize downstream. In the absence of any biosecurity mitigation, this could be a significant impact.



5.1.1.2.2 *Operational Phase*

As the bridge is an existing bridge, there is no potential for operational phase impacts to arise as a result of the proposed rehabilitation works. There will be no change of use for the bridge site.

5.1.1.3 *River lamprey*

5.1.1.3.1 *Construction Phase*

Ballinloughane Bridge is located within the Lower River Shannon SAC. O'Connor (2006) found Brook / River lampreys to be present in the River Feale, but no lampreys were recorded in the River Galey during this survey. However, suitable habitat is present in the River Galey so the precautionary approach is taken. Nonetheless, this species is present downstream.

Impacts on River lamprey are the same as those discussed for Brook lamprey in section 5.1.1.2 above. This species could be impacted by water quality issues arising from the works at the site, or by disturbance if present in the River Galey at the site. This species could also be affected by any invasive species impacts as this could degrade their habitat.

5.1.1.3.2 *Operational Phase*

As the bridge is an existing bridge, there is no potential for operational phase impacts to arise as a result of the proposed rehabilitation works. There will be no change of use for the bridge site.

5.1.1.4 *Salmon*

5.1.1.4.1 *Construction Phase*

This species is present downstream in the River Feale and may also use the Galey River at the site. Salmonid habitat is present here. Despite the arterial drainage works in the past, there is the potential for this species to be present in the river at the site. This species could be affected by impacts arising from the proposed rehabilitation works, such as water quality, disturbance if present at the site, and invasive species.

Salmon could be affected by water quality impacts arising from the proposed rehabilitation works. Water quality issues could arise from an increase in suspended solids and / or contaminants in the watercourse which can be generated by the activities at the works site. Such as when raking out the mortar joints and removing debris. These can also come from accidental spillages of oil / fuel, cement / concrete and / or root herbicide that may be used for the bridge rehabilitation works. It is proposed to replace the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. There is a risk of concrete / cement spillages instream which can alter the pH of watercourses. Dewatering of areas also poses risks to water quality. In such situations there is also a risk of water quality impacts arising from the potential accidental release of sand into the river from sandbags used around dewatered areas in the event of a flood. Any water pollution will affect salmon and their habitats downstream. Salmonid habitat is present at the site and this could be adversely affected by water quality. If salmon are present at the site, they could also be affected by disturbance impacts arising if instream works are required.

Machinery and personnel working on site could also lead to the introduction of invasive species to the site. Invasive species can quickly take over an ecosystem and disrupt the balance of the system.



Invasive species can also spread rapidly and could affect the habitats that Salmon utilize. In the absence of any biosecurity mitigation, this could be a significant impact.

5.1.1.4.2 Operational Phase

As the bridge is an existing bridge, there is no potential for operational phase impacts to arise as a result of the proposed rehabilitation works. There will be no change of use for the bridge site.

5.1.1.5 Otter

5.1.1.5.1 Construction Phase

This species is likely to use the River Galey at the site. There is salmonid habitat present at the site which would be a potential food source for Otter. Otter may use this stretch for commuting or foraging. This species could be affected by impacts arising from the proposed rehabilitation works, such as water quality, disturbance if present at the site, and invasive species.

Otters could also be affected indirectly by water quality impacts arising from the proposed rehabilitation works. Water quality issues could arise from an increase in suspended solids and / or contaminants in the watercourse which can be generated by the activities at the works site. Such as when raking out the mortar joints and removing debris. These can also come from accidental spillages of oil / fuel, cement / concrete and / or root herbicide that may be used for the bridge rehabilitation works. It is proposed to replace the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. There is a risk of concrete / cement spillages instream which can alter the pH of watercourses. Dewatering of areas also poses risks to water quality. In such situations there is also a risk of water quality impacts arising from the potential accidental release of sand into the river from sandbags used around dewatered areas in the event of a flood. Any water pollution will affect Otters food sources, i.e. fish, and therefore can result in an indirect impact on this species. If Otters are present at the site, they could also be affected by disturbance impacts through the increase in noise and human activity for the duration of the construction works on site.

Machinery and personnel working on site could also lead to the introduction of invasive species to the site. Invasive species can quickly take over an ecosystem and disrupt the balance of the system. Invasive species can also spread rapidly and could affect the habitats that otters utilize, particularly riparian areas as this is a semi-aquatic species. In the absence of any biosecurity mitigation, this could be a significant impact.

5.1.1.5.2 Operational Phase

As the bridge is an existing bridge, there is no potential for operational phase impacts to arise as a result of the proposed rehabilitation works. There will be no change of use for the bridge site.

6. POTENTIAL FOR IN-COMBINATION EFFECTS

The standard data Natura 2000 form for the Lower River Shannon SAC lists the threats and pressures currently having an impact on this protected site. There are no impacts listed that are having a high impact on this SAC. The following are noted as having a medium impact on the SAC: Fertilisation, urbanised areas, human habitation, air pollution, air-borne pollutants, discharges, eutrophication (natural), grazing, polderisation and reclamation of land from sea, estuary or marsh.



A search for planning applications was carried out on the online National Planning Applications Database (NPAD). The nearest planning application is c. 1.7km north-east of Ballinloughane Bridge. This application is from 2014 and was granted based on conditions. This application included demolishing the existing dwelling house on site and to construct a new storey and a half style dwelling house with a wastewater treatment system and polishing filter including all associated site works (Planning Ref No.: 14993). Limerick County Council completed a Screening Assessment which found that there would be no significant effects as a result of the development. The wastewater treatment plant discharges to groundwater and is a secondary treatment plant. There are no other planning applications within the vicinity of Ballinloughane Bridge.

There are no EPA Biological Water Quality Monitoring Stations upstream of Ballinloughane Bridge, but the nearest station downstream is located in Athea. This station was last monitored in 2005 and was given a rating of Q4 (EPA Station Code: 23G01 0100). The nearest station downstream of here was also rated as Q4 but in 2017 (EPA Station Code: 23G01 0200). Water quality in the River Galey declines south-west of Moyvane town, where there is a rating of Q3-4 in 2017 (EPA Station Code: 23G01 0400). The furthest downstream station upstream of its confluence with the River Feale was rated as Q3 in 2017 (EPA Station Code: 23G01 0700). There are no monitoring stations on the River Feale downstream of the River Galey confluence. Arterial drainage works have been undertaken on the River Galey (O'Connor, 2006). The Athea WwTP discharges into the River Galey c. 7.1rkm downstream of Ballinloughane Bridge. The AER for the plant notes that it is operating within capacity but notes incidents such as uncontrolled releases of sewage and spillages, and that the WwTP discharge was not compliant with the ELVs in the discharge licence based on the 2019 results (Irish Water, 2019). There are also numerous other WwTP discharges in the catchment, such as the WwTPs at Abbeyfeale and Listowel on the River Feale.

Taking the above information into account, concerning background pressures in the area and the list of threats and pressures on the SAC downstream of Ballinloughane Bridge, there is some potential for cumulative water quality impacts to arise. These impacts could act in-combination with the existing WwTP discharges in the catchment, the pressures of fertilisation, discharges, grazing and human habitation. Water quality impacts may arise during the rehabilitation works at Ballinloughane Bridge, which could travel downstream and result in a larger impact cumulatively with the existing pressures on the catchment and SAC. It is noted that the works at Ballinloughane Bridge in the context of the SAC are minor and are likely to be short-term. This is unlikely therefore to result in a significant increase in water quality pollution. It is considered that with the mitigation measures outlined in this NIS to protect water quality, cumulative impacts will not be significant.

7. MITIGATION

Mitigation measures for the protection of the Lower River Shannon SAC and their qualifying interests have been prepared. The proposed rehabilitation works to Ballinloughane Bridge have been identified as having some potential to cause water quality, disturbance and invasive species impacts affecting the qualifying interests of these sites.

7.1 Detailed Method Statement and CEMP

Prior to commencement of works a site specific Construction and Environmental Management Plan and Method Statement must be drawn up detailing precisely how the works will be carried out in compliance with the necessary mitigation measures. These documents will provide the precise details of the works to be undertaken and how each process and each step of the works will be carried out to adhere to the



mitigation measures: timing of works, limiting access outside of the proposed works area, biosecurity protocols and water quality protection measures.

The CEMP and Method Statement will be prepared following best practice procedure and guidelines, having due regard to the relevant sections of the following:

- IFI, (2010) '*Biosecurity Protocol for Field Survey Work*'
- IFI, (2016) '*Guidelines of protection of Fisheries during construction works in and adjacent to waters*'
- NRA, (2010) '*The Management of Noxious Weeds and Non-Native Invasive Plant Species on National Roads*'
- NRA, (2008) '*Guidelines for the Crossing of Watercourses During the Construction of National Road Schemes*'
- CIRIA (2006) '*Control of Water Pollution from Linear Construction Projects- Site Guide (C649)*'
- CIRIA (2005) '*Environmental Good Practice – Site Guide (C650)*'

7.2 Avoidance

7.2.1 Footprint of works

The footprint of the works will be limited and works areas will be surrounded by silt fences and sandbags to help prevent water contamination from the proposed bridge works. Appropriate set back distances from the river will be maintained. The main site compound will not be located within 5m of the river and will be located on dry land.

Access to the river for instream bridge works should be limited to a single access route to minimise the footprint of works. Impacts to the riparian habitats will be kept to a minimum with natural re-vegetation after the completion of works.

Access under the bridge must be provided at all times to allow safe passage along the river channel for wildlife such as Otter.

7.2.2 Timing of works

The proposed works will be undertaken outside of the salmonid close season and outside of the lamprey spawning season, with works permitted from July - September. The salmonid close season begins on the 30th of September and therefore works will have to be completed before this time. Works should also be limited to daylight hours to avoid potential disturbance to nocturnal animals foraging at the subject bridge site, namely Otter. Works should be limited to between 8am and 5pm.

7.3 Water Quality Protection

Any oiling or refueling of machinery that may be required will be undertaken away from the watercourse. Any oils or fuels that may be required for minor machinery used during the proposed works will be stored appropriately in bunded tanks in the site compound (which should be fenced off 5m from the river) to ensure no spillages occur. Machinery will be well-maintained and checked for leaks prior to its use on site and prior to working in-stream. Spill kits will be used and any leaks on site will be cleaned immediately. The site compound will have security to deter vandalism, theft and unauthorised access.



Any tool washing and waste / grey water from the site will be stored securely until it can be removed from site. There could be impacts from welfare facilities for employees and to mitigate this portaloos should be provided and regularly maintained by a licenced facility and all sewage appropriately removed from the site to an authorised treatment plant.

No concrete / cement mixing will be carried out at the riverbank area; mixing within the mixing area in the site compound will be controlled by the contractor, with all wash water, tool washings and any waste / grey water stored securely and removed; no waste will be stored on site; concrete / cement and grout work must be carried out behind the silt fencing and sandbags, in the dry works area. Precast concrete will be used wherever possible. When removing the existing deck of the bridge, care will be taken to ensure no debris from the concrete deck will fall to the river below. A tarp or similar material will be placed underneath the bridge to catch any debris that may fall during the replacement and reinstallation of the bridge deck. Storage areas for concrete / cement and grout required for the works will be included in the site compound.

The waste from any vegetation removal will also have to be dealt with appropriately away from the river. Silt fences may be required here to ensure vegetation debris does not flow downstream and can be appropriately removed. Any mature trees within the vegetation removal area should be endeavored to be retained where possible to minimise debris. The chosen ecologically safe herbicide will be named in the Method Statement and stored safely and appropriately in the site compound. A detailed description of its use will be provided in the Method Statement. When removing vegetation from the bridge ensure no debris from damaged section of the bridge remains in the water. All work carried out on the bridge including raking out joints, flushing them to remove loose material and dust along with the construction of new walls will be carried out such that no debris will enter the river.

Silt fences will be placed on the outside of the works area first before works commence and before any excavations, with sandbags placed inside to ensure no impacts regarding suspended solids arise. Details of the sandbags will be included in the method statement. The site ecologist will ensure that any sandbags and silt fences are erected correctly. The works area will be fenced to avoid trampling or disturbance by personnel outside of the works area or by public access to the site.

Prior to any instream works occurring, the site ecologist will agree a 5-day weather window of low flow conditions with the contractor to minimise the risk of works in the river during a flood event. The extent of instream works with regard to the methodology for damming of the works area is to be agreed by the contractor in the site specific detailed CEMP, but the mitigations to protect water quality and the integrity of the river corridor remain regardless.

If there is a requirement for pumping out water from the dammed works area silt bags will be installed at the end of the pumping pipes to filter water to be pumped from the dammed section of the river. These silt bags will be specified in the detailed method statement to adequately cope with the volume of water and will be maintained so it is operating effectively with suspended solids loadings at the end of pipe at less than 10 mg/l. Any dewatering must pass through a silt bag, which would be similar in nature to flood water in the area.

7.4 Biosecurity

No invasive species were recorded at the site during the site survey, but precautions will be taken to ensure that no invasive species are introduced due to the proposed works. Biosecurity measures will follow NRA guidelines '*The Management of Noxious Weeds and Non-native Invasive Plant Species on*



National Roads' (NRA, 2010) and the IFI guidelines '*Biosecurity Protocol for Field Survey Work*' (IFI, 2010).

Particular attention will have to be given to sterilising all equipment / work gear that will come in contact with the river, by using suitable disinfectants such as Virkon aquatic. All equipment to be used on site will be steam cleaned before dispatching to site, and all hired equipment will be treated on site with an approved biocide / cleaning agent. A disinfection / cleaning station will be set up next to the site compound and 5m back from the river. Any depot providing material for the works should be able to provide either verbal or written certificate to ensure no non-native invasive species are present in the obtained material.

7.5 Site ecologist

A site ecologist will need to be appointed for the duration of the proposed works. The site ecologist will work with the contractor to draw up the precise site-specific method statement prior to the commencement of works. This method statement will include precise details of the works, accessing areas, equipment / machinery / materials etc. for each stage of the project. This will ensure that the works are carried out following the best practice guidelines and the mitigation measures provided in this document with minimal impacts on the Natura 2000 network. The ecologist will be on site on a regular basis to ensure compliance with the environmental and ecological protection measures specified in the method statement.

A site induction will be carried out by the site ecologist for all contractors' personnel including sub-contractor staff attending the site. The site induction will ensure that any person working on site is aware of the mitigation measures that will be implemented on site. This will include limiting access to within the works area, timing of works, water quality protection measures and biosecurity protocols. This will be the first element of the works undertaken.

The site ecologist will over-see the set-up of dry works areas if any are required for the proposed works. Any lamprey and fish species potentially caught behind the dammed area will be translocated upstream by the ecologist who will have obtained a section 14 license for this activity.

8. RESIDUAL IMPACTS

The overall aim of the Habitats Directive is to maintain or restore the favourable conservation status of habitats and species of community interest. Favourable conservation status is defined for Annex I habitats and Annex II species in the Habitat Directive (1992):

Article 1 (e)

Conservation status of a natural habitat means the sum of the influences acting on a natural habitat and its typical species that may affect its long-term natural distribution, structure and functions as well as the long-term survival of its typical species within the territory referred to in Article 2.

The conservative status of a natural habitat will be taken as 'favourable' when: its natural range and areas it covers within that range are stable or increasing, and the specific structure and functions which are necessary for its long-term maintenance exist and are likely to continue to exist for the foreseeable future.



Article 1 (i)

Conservation status of a species means the sum of the influences acting on the species concerned that may affect the long-term distribution and abundance of its populations within the territory referred to in Article 2.

The conservation status will be taken as 'favourable' when: population dynamics data on the species concerned indicate that it is maintaining itself on a long-term basis as a viable component of its natural habitats, and the natural range of the species is neither being reduced nor is likely to be reduced for the foreseeable future, and there is, and will probably continue to be, a sufficiently large habitat to maintain its populations on a long-term basis.

Favourable conservation status of a habitat is achieved when:

- its natural range, and area it covers within that range, are stable or increasing, and
- the specific structure and functions which are necessary for its long-term maintenance exist and are likely to continue to exist for the foreseeable future, and
- the conservation status of its typical species is favourable.

The favourable conservation status of a species is achieved when:

- population dynamics data on the species concerned indicate that it is maintaining itself on a long-term basis as a viable component of its natural habitats, and
- the natural range of the species is neither being reduced nor is likely to be reduced for the foreseeable future, and
- there is, and will probably continue to be, a sufficiently large habitat to maintain its populations on a long-term basis.

The Conservation Objectives of the Lower River Shannon SAC are detailed in one site specific report prepared by the National Parks and Wildlife Service (NPWS, 2012). The current assessment utilizes the site-specific conservation objectives and the national 'Status of EU Protected Habitats and Species in Ireland' Report (NPWS, 2019a; NPWS, 2019b; NPWS, 2019c).

Ballinloughane Bridge is located within the Lower River Shannon SAC. The proposed works mainly comprise replacing the bridge deck and beams with a new precast concrete bridge beam and insitu concrete deck. It is unlikely that sea lamprey would be found at the site and they were not recorded here during previous surveys of the Galey downstream of Athea (O'Connor, 2006). River / Brook lamprey were also not recorded but suitable habitat is present and therefore the precautionary principle is applied here. Salmon are present downstream in the River Feale and may also use the Galey River at the site. Otters are considered likely to use the site for foraging and commuting. Impacts on these Qualifying Interests were identified as water quality, disturbance and invasive species. Water quality impacts could arise from increased suspended solids, contaminants entering the watercourse, spillages of oils / fuels, cement / concrete and / or root herbicide. Dewatering of areas also poses risks to water quality. Disturbance may arise through increased noise and human activity on site. Invasive species could also be introduced on site through vectors such as machinery or tools / personnel on site. Mitigation provided includes a detailed method statement and CEMP, limiting the footprint and timing of the works, water quality protection measures, biosecurity measures and a site ecologist. No significant impacts are envisaged, and with mitigation, the impacts will be reduced insofar as possible.

The implementation of the provided mitigation measures is considered to be sufficient to minimise any risk of impacts to the SAC to imperceptible in scale. There are no impacts arising from the proposed development which could affect the conservation status of the Annex I habitats or Annex II species listed as qualifying interests of the SAC.



The proposed development will comply with the required mitigation to ensure that there will be no residual impacts arising.

Table 4 Potential Impacts, Mitigation Measures and Residual Impacts for each of the affected Q.I.s.

Qualifying Interest	Impact	Mitigation Measures	Residual Impact
Sea lamprey	Water quality; invasive species	Detailed Method Statement and CEMP following listed guidelines; limiting the footprint of the works; silt fences and sandbags; site compound not within 5m of river and on dry land; access limited to single route for any instream works; impacts to riparian habitats minimised with natural re-vegetation; timing of works outside lamprey spawning season with works permitted from July-September; any oiling / refuelling away from watercourse; oils / fuels in bunded tanks in site compound; machinery well maintained and checked for leaks; spill kits provided; security at site compound; tool washing / grey water stored securely until removed off site; portaloo provided and regularly maintained by licensed facility; no vegetation debris instream; silt fences on outside of works areas; sand bags placed inside if required; works area fenced off; no concrete / cement mixing at river bank area; precast concrete used where possible; tarp or similar material placed underneath bridge to catch potential debris; no waste stored on site; chosen ecologically safe herbicide named in method statement and stored securely in site compound; site ecologist to agree 5 day weather window of low flow conditions for any instream works; if pumping out water from dewatered area required, silt bags installed at end of pipes; NRA guidelines followed for biosecurity; sterilise all equipment / work gear that comes into contact with river, all equipment steam cleaned before arriving on site; site ecologist employed; site ecologist to give site induction; site ecologist to oversee set up of dry works areas and any lamprey species potentially caught will be translocated upstream with section 14 licence by site ecologist	No residual impacts.
Brook lamprey	Water quality; disturbance; invasive species	Detailed Method Statement and CEMP following listed guidelines; limiting the footprint of the works; silt fences and sandbags; site compound not within 5m of river and on dry land; access limited to single route for any instream works; impacts to riparian habitats minimised with natural re-vegetation; timing of works outside lamprey spawning season with works permitted from July-September; works limited to daytime hours; any oiling / refuelling away from watercourse; oils / fuels in bunded tanks in site compound; machinery well maintained and checked for leaks; spill kits provided; security at site compound; tool washing / grey water stored securely until removed off site; portaloo provided and regularly maintained by licensed facility; no vegetation debris instream; silt fences on outside of works areas; sand bags placed inside if required; works area fenced off; no concrete / cement mixing at river bank area; precast concrete used where possible; tarp or similar material placed underneath bridge to catch potential debris; no waste stored on site; chosen ecologically safe herbicide named in method statement and stored securely in site compound; site ecologist to agree 5 day weather window of low flow conditions for any instream works; if pumping out water from dewatered area required, silt bags installed at end of pipes; NRA guidelines followed for biosecurity; sterilise all equipment / work gear that comes into contact with river, all equipment steam cleaned before arriving on site; site ecologist employed; site ecologist to give site induction; site ecologist to oversee set up of dry works areas and any lamprey species potentially caught will be translocated upstream with section 14 licence by site ecologist	No residual impacts.
River lamprey	Water quality; disturbance; invasive species	As above for Brook lamprey.	No residual impacts.



Qualifying Interest	Impact	Mitigation Measures	Residual Impact
Salmon	Water quality; disturbance; invasive species	Detailed Method Statement and CEMP following listed guidelines; limiting the footprint of the works; silt fences and sandbags; site compound not within 5m of river and on dry land; access limited to single route for any instream works; impacts to riparian habitats minimised with natural re-vegetation; timing of works outside salmonid spawning season with works permitted from July-September; works limited to daytime hours; any oiling / refuelling away from watercourse; oils / fuels in bunded tanks in site compound; machinery well maintained and checked for leaks; spill kits provided; security at site compound; tool washing / grey water stored securely until removed off site; portaloos provided and regularly maintained by licensed facility; no vegetation debris instream; silt fences on outside of works areas; sand bags placed inside if required; works area fenced off; no concrete / cement mixing at river bank area; precast concrete used where possible; tarp or similar material placed underneath bridge to catch potential debris; no waste stored on site; chosen ecologically safe herbicide named in method statement and stored securely in site compound; site ecologist to agree 5 day weather window of low flow conditions for any instream works; if pumping out water from dewatered area required, silt bags installed at end of pipes; NRA guidelines followed for biosecurity; sterilise all equipment / work gear that comes into contact with river, all equipment steam cleaned before arriving on site; site ecologist employed; site ecologist to give site induction; site ecologist to oversee set up of dry works areas and any fish species potentially caught will be translocated upstream with section 14 licence by site ecologist	No residual impacts.
Otter	Water quality; disturbance; invasive species	Detailed Method Statement and CEMP following listed guidelines; limiting the footprint of the works; silt fences and sandbags; site compound not within 5m of river and on dry land; access limited to single route for any instream works; impacts to riparian habitats minimised with natural re-vegetation; access at all times under the bridge for Otter; works limited to daytime hours; any oiling / refuelling away from watercourse; oils / fuels in bunded tanks in site compound; machinery well maintained and checked for leaks; spill kits provided; security at site compound; tool washing / grey water stored securely until removed off site; portaloos provided and regularly maintained by licensed facility; no vegetation debris instream; silt fences on outside of works areas; sand bags placed inside if required; works area fenced off; no concrete / cement mixing at river bank area; precast concrete used where possible; tarp or similar material placed underneath bridge to catch potential debris; no waste stored on site; chosen ecologically safe herbicide named in method statement and stored securely in site compound; site ecologist to agree 5 day weather window of low flow conditions for any instream works; if pumping out water from dewatered area required, silt bags installed at end of pipes; NRA guidelines followed for biosecurity; sterilise all equipment / work gear that comes into contact with river, all equipment steam cleaned before arriving on site; site ecologist employed; site ecologist to give site induction; site ecologist to oversee set up of dry works areas	No residual impacts.



9. CONCLUSION STATEMENT

The provisions of Article 6 of the 'Habitats' Directive 92/43/EC (2000) defines 'integrity' as the: 'coherence of the site's ecological structure and function, across its whole area, or the habitats, complex of habitats and/or population of species for which the site is or will be classified'.

Mitigation measures proposed ensure that there are no residual impacts on the Lower River Shannon SAC. The potential impacts identified, including water quality, disturbance and invasive species, will be successfully reduced to imperceptible in scale following the implementation of the mitigation measures in this NIS. It has therefore been concluded that following an examination, analysis and evaluation of the relevant information, including in particular the nature of the predicted impacts from the proposed works, and with the implementation of the mitigation measures proposed, that the proposed works do not pose a risk adversely affecting the integrity of any Natura 2000 site, either alone or in-combination with other plans or projects.



REFERENCES

Bowers Marriott, B., (1997). Practical Guide to Environmental Impact Assessment: A Practical Guide. Published by McGraw-Hill Professional, 1997, 320 pp.

CIRIA, (2001). Control of Water Pollution from Construction sites- Guidance for Consultants and Contractors (C532). 6 Storey's Gate, Westminster, London.

<http://www.orkneywind.co.uk/advice/SEPA%20Pollution%20Advice/ciria%20c532.pdf>

CIRIA, (2002). Control of Water Pollution on Construction Sites- Guide to Good Practice (SP156). 6 Storey's Gate, Westminster, London.

CIRIA, (2005). Environmental Good Practice – Site Guide (C650). 6 Storey's Gate, Westminster, London.

CIRIA, (2006). Control of Water Pollution from Linear Construction Projects- Site Guide (C649). 6 Storey's Gate, Westminster, London.

CIRIA, (2006). Control of Water Pollution from Linear Construction Projects -Technical Guidance (C648). 6 Storey's Gate, Westminster, London.

<http://bailey.persona-pi.com/Public-Inquiries/M4%20-%20Revised/12.2.20.pdf>

DoEHLG, (2010) '*Appropriate Assessment of Plans and Projects in Ireland. Guidance for Planning Authorities*'. National Parks and Wildlife Service, Department of the Environment, Heritage and Local Government, Dublin.

https://www.npws.ie/sites/default/files/publications/pdf/NPWS_2009_AA_Guidance.pdf

Ecofact, (2020). *Proposed Bridge Rehabilitation Programme 2020, Ballinloughane Bridge, Co. Limerick: Screening for Appropriate Assessment Report*. Ecofact Environmental Consultants Ltd., Tait Business Centre, Dominic St., Limerick.

European Commission, (2001). *Assessment of plans and projects significantly affecting Natura 2000 sites: Methodological guidance on the provisions of Article 6(3) and (4) of the Habitats Directive 92/43/EEC*. European Commission Environment, Brussels.

European Commission, (2007). *Guidance document on Article 6(4) of the 'Habitats Directive' 92/43/EEC: Clarification of the concepts of: alternative solutions, imperative reasons of overriding public interests, compensatory measures, overall coherence and opinion of the Commission*. European Commission, Brussels

European Communities Environmental Objectives (Freshwater pearl mussel) Regulations. Statutory Instrument No. 296 of 2009.

European Communities Environmental Objectives (Surface waters) Regulations. Statutory Instrument No. 272 of 2009.

IFI, (2010). IFI Biosecurity Protocol for Field Survey Work. Inland Fisheries Ireland, Swords Business Campus, Swords, Co. Dublin, Ireland.

<https://www.fisheriesireland.ie/documents/73-biosecurity-protocol-for-field-survey-work-1/file.html>



IFI (2016) Guidelines on Protection of Fisheries during Construction Works in and Adjacent to Waters. Inland Fisheries Ireland, 3044 Lake Drive, Citywest Business Campus Co. Dublin. IFI/2016/1-4298.
<https://www.fisheriesireland.ie/documents/624-guidelines-on-protection-of-fisheries-during-construction-works-in-and-adjacent-to-waters/file.html>

Irish Water (2019). Annual Environmental Report: Athea D0508-01.
http://www.epa.ie/licences/lic_eDMS/090151b280769461.pdf

NPWS (2012) Conservation Objectives: Lower River Shannon SAC 002165. Version 1.0. National Parks and Wildlife Service, Department of Arts, Heritage and the Gaeltacht.
https://www.npws.ie/sites/default/files/protected-sites/conservation_objectives/CO002165.pdf

NPWS, (2017a). Natura 2000 – Standard Data Form: Lower River Shannon SAC. National Parks and Wildlife Service, Department of Arts, Heritage and the Gaeltacht.
<https://www.npws.ie/sites/default/files/protected-sites/natura2000/NF002165.pdf>

NPWS (2019a). *The Status of EU Protected Habitats and Species in Ireland*. Volume 1: Summary Overview. Unpublished NPWS Report.
https://www.npws.ie/sites/default/files/publications/pdf/NPWS_2019_Vol1_Summary_Article17.pdf

NPWS, (2019b). *The Status of EU Protected Habitats and Species in Ireland*. Volume 2: Habitat Assessments. Unpublished NPWS Report.
https://www.npws.ie/sites/default/files/publications/pdf/NPWS_2019_Vol2_Habitats_Article17.pdf

NPWS, (2019c). *The Status of EU Protected Habitats and Species in Ireland*. Volume 3: Species Assessments. Unpublished NPWS Report.
https://www.npws.ie/sites/default/files/publications/pdf/NPWS_2019_Vol3_Species_Article17.pdf

NRA, (2008a). Guidelines for the Crossing of Watercourses During the Construction of National Road Schemes. National Roads Authority, St Martin's House, Waterloo Roads, Dublin 4.
<http://www.tii.ie/tii-library/environment/construction-guidelines/Guidelines-for-the-Crossing-of-Watercourses-during-the-Construction-of-National-Road-Schemes.pdf>

NRA, (2010). Guidelines on the Management of Noxious Weeds and Non-native Invasive Plant Species on National Roads. National Roads Authority, St Martin's House, Waterloo Roads, Dublin 4.
<http://www.tii.ie/technical-services/environment/construction/Management-of-Noxious-Weeds-and-Non-Native-Invasive-Plant-Species-on-National-Road-Schemes.pdf>

O'Connor, W. (2006). A Baseline survey of juvenile lamprey populations in the River Feale catchment. *Irish Wildlife Manuals*, No. 22. National Parks and Wildlife Service, Department of Environment, Heritage and Local Government, Dublin, Ireland.
<https://www.npws.ie/sites/default/files/publications/pdf/IWM22.pdf>

Punch Consulting Engineers (2021). 201156 LCCC 2021 Bridge Rehabilitation Scheme. Stage 2 – 2021. Summary Description of the Bridge Works.



PLATES



Plate 1 Ballinloughane Bridge over the River Galey in Co. Limerick.



Plate 2 River Galey upstream of Ballinloughane Bridge.



APPENDIX 1 NPWS SITE SYNOPSIS

SITE NAME: LOWER RIVER SHANNON SAC

SITE CODE: 002165

This very large site stretches along the Shannon valley from Killaloe to Loop Head/ Kerry Head, a distance of some 120km. The site thus encompasses the Shannon, Feale, Mulkear and Fergus Estuaries, the freshwater lower reaches of the River Shannon (between Killaloe and Limerick), the freshwater stretches of much of the Feale and Mulkear catchments and the marine area between Loop Head and Kerry Head. The Shannon and Fergus flow through Carboniferous limestone as far as Foynes, but west of Foynes Namurian shales and flagstones redominate (except at Kerry Head, which is formed from Old Red Sandstone). The eastern sections of the Feale catchment flow through Namurian Rocks and the western stretches through Carboniferous Limestone. The Mulkear flows through Lower Palaeozoic Rocks in the upper reaches before passing through Namurian Rocks, followed by Lower Carboniferous Shales and Carboniferous Limestone. The Mulkear River itself, immediately north of Pallasgreen, passes through an area of Rhyolites, Tuffs and Agglomerates. Rivers within the subcatchment of the Feale include the Galey, Smearlagh, Oolagh, Allaughaun, Owveg, Clydagh, Caher, Breanagh and Glenacarneay. Rivers within the sub-catchment of the Mulkear include the Killeenagarriff, Annagh, Newport, the Dead River, the Bilboa, Glashacloonaraveela, Gortnageragh and Cahernahallia.

The site is a candidate SAC selected for lagoons and alluvial wet woodlands, both habitats listed on Annex I of the E.U. Habitats Directive. The site is also selected for floating river vegetation, *Molinia* meadows, estuaries, tidal mudflats, Atlantic salt meadows, Mediterranean salt meadows, *Salicornia* mudflats, sand banks, perennial vegetation of stony banks, sea cliffs, reefs and large shallow inlets and bays all habitats listed on Annex I of the E.U. Habitats Directive. The site is also selected for the following species listed on Annex II of the same directive – Bottle-nosed Dolphin, Sea Lamprey, River Lamprey, Brook Lamprey, Freshwater Pearl Mussel, Atlantic salmon and Otter.

The Shannon and Fergus Estuaries form the largest estuarine complex in Ireland. They form a unit stretching from the upper tidal limits of the Shannon and Fergus Rivers to the mouth of the Shannon estuary (considered to be a line across the narrow strait between Kilcredaun Point and Kilconly Point). Within this main unit there are several tributaries with their own 'sub-estuaries' e.g. the Deel River, Mulkear River, and Mague River. To the west of Foynes, a number of small estuaries form indentations in the predominantly hard coastline, namely Poulnasherry Bay, Ballylongford Bay, Clonderalaw Bay and the Feale or Cashen River Estuary.

Both the Fergus and inner Shannon estuaries feature vast expanses of intertidal mudflats, often fringed with saltmarsh vegetation. The smaller estuaries also feature mudflats, but have their own unique characteristics, e.g. Poulnasherry Bay is stony and unusually rich in species and biotopes. Plant species are typically scarce on the mudflats, although there are some Eel-grass beds (*Zostera* spp.) and patches of green algae (e.g. *Ulva* sp. and *Enteromorpha* sp.). The main macro-invertebrate community, which has been noted from the inner Shannon and Fergus estuaries, is a *Macoma- Scrobicularia-Nereis* community.

In the transition zone between mudflats and saltmarsh, specialised colonisers of mud predominate: swards of Common Cord-grass (*Spartina anglica*) frequently occur in the upper parts of the estuaries. Less common are swards of Glasswort (*Salicornia europaea* agg.). In the innermost parts of the estuaries, the tidal channels or creeks are fringed with species such as Common Reed (*Phragmites australis*) and Club-rushes (*Scirpus maritimus*, *S. tabernaemontani* and *S. triquetrus*). In addition to the



nationally rare Triangular Club-rush (*Scirpus triquetrus*), two scarce species are found in some of these creeks (e.g. Ballinacurra Creek): Lesser Bulrush (*Typha angustifolia*) and Summer Snowflake (*Leucojum aestivum*).

Saltmarsh vegetation frequently fringes the mudflats. Over twenty areas of estuarine saltmarsh have been identified within the site, the most important of which are around the Fergus Estuary and at Ringmoylan Quay. The dominant type of saltmarsh present is Atlantic salt meadow occurring over mud. Characteristic species occurring include Common Saltmarsh Grass (*Puccinellia maritima*), Sea Aster (*Aster tripolium*), Thrift (*Armeria maritima*), Sea-milkwort (*Glaux maritima*), Sea Plantain (*Plantago maritima*), Red Fescue (*Festuca rubra*), Creeping Bent (*Agrostis stolonifera*), Saltmarsh Rush (*Juncus gerardi*), Long-bracted Sedge (*Carex extensa*), Lesser Seaspurrey (*Spergularia marina*) and Sea Arrowgrass (*Triglochin maritima*). Areas of Mediterranean salt meadows, characterised by clumps of Sea Rush (*Juncus maritimus*) occur occasionally. Two scarce species are found on saltmarshes in the vicinity of the Fergus Estuary: a type of robust Saltmarsh-grass (*Puccinellia foucaudii*), sometimes placed within the compass of Common Saltmarsh-grass (*Puccinellia maritima*) and Hard-grass (*Parapholis strigosa*).

Saltmarsh vegetation also occurs around a number of lagoons within the site. The two which have been surveyed as part of a National Inventory of Lagoons are Shannon Airport Lagoon and Cloonconeen Pool. Cloonconeen Pool (4-5 ha) is a natural sedimentary lagoon impounded by a low cobble barrier. Seawater enters by percolation through the barrier and by overwash. This lagoon represents a type which may be unique to Ireland since the substrate is composed almost entirely of peat. The adjacent shore features one of the best examples of a drowned forest in Ireland. Aquatic vegetation in the lagoon includes typical species such as Beaked Tasselweed (*Ruppia maritima*) and green algae (*Cladophora* sp.). The fauna is not diverse, but is typical of a high salinity lagoon and includes six lagoon specialists (*Hydrobia ventrosa*, *Cerastoderma glaucum*, *Lekanesphaera hookeri*, *Palaemonetes varians*, *Sigara stagnalis* and *Enochrus bicolor*). In contrast, Shannon Airport Lagoon (2 ha) is an artificial saline lake with an artificial barrier and sluiced outlet. However, it supports two Red Data Book species of Stonewort (*Chara canescens* and *Chara cf. connivens*).

Most of the site west of Kilcredaun Point/Kilconly Point is bounded by high rocky sea cliffs. The cliffs in the outer part of the site are sparsely vegetated with lichens, Red Fescue, Sea Beet (*Beta vulgaris*), Sea Campion (*Silene maritima*), Thrift and Plantains (*Plantago* spp.). A rare endemic Sea Lavender (*Limonium recurvum* subsp. *pseudotranswallinum*) occurs on cliffs near Loop Head. Cliff-top vegetation usually consists of either grassland or maritime heath. The boulder clay cliffs further up the estuary tend to be more densely vegetated, with swards of Red Fescue and species such as Kidney Vetch (*Anthyllis vulneraria*) and Bird's-foot Trefoil (*Lotus corniculatus*).

The site supports an excellent example of a large shallow inlet and bay. Littoral sediment communities in the mouth of the Shannon Estuary occur in areas that are exposed to wave action and also in areas extremely sheltered from wave action. Characteristically, exposed sediment communities are composed of coarse sand and have a sparse fauna. Species richness increases as conditions become more sheltered. All shores in the site have a zone of sand hoppers at the top and below this each of the shores has different characteristic species giving a range of different shore types in the cSAC.

The intertidal reefs in the Shannon Estuary are exposed or moderately exposed to wave action and subject to moderate tidal streams. Known sites are steeply sloping and show a good zonation down the shore. Well developed lichen zones and littoral reef communities offering a high species richness in the sublittoral fringe and strong populations of *Paracentrotus lividus* are found. The communities found are tolerant to sand scour and tidal streams. The infralittoral reefs range from sloping platforms with some



vertical steps to ridged bedrock with gullies of sand between the ridges to ridged bedrock with boulders or a mixture of cobbles, gravel and sand. Kelp is very common to about 18m. Below this it becomes rare and the community is characterised by coralline crusts and red foliose algae. Flowing into the estuaries are a number of tidal rivers.

Other coastal habitats that occur within the site include the following:

- Stony beaches and bedrock shores - these shores support a typical zonation of seaweeds (*Fucus* spp., *Ascophyllum nodosum* and kelps).
- Shingle beaches - the more stable areas of shingle support characteristic species such as Sea Beet, Sea Mayweed (*Matricaria maritima*), Sea Campion and Curled Dock (*Rumex crispus*).
- Sandbanks which are slightly covered by sea water at all times – there is a known occurrence of sand/gravel beds in the area from Kerry Head to Beal Head.
- Sand dunes - a small area of sand dunes occurs at Beal Point. The dominant species is Marram Grass (*Ammophila arenaria*).

Freshwater rivers have been included in the site, most notably the Feale and Mulkear catchments, the Shannon from Killaloe to Limerick (along with some of its tributaries, including a short stretch of the Kilmastulla River), the Fergus up as far as Ennis, and the Cloon River. These systems are very different in character: the Shannon being broad, generally slow-flowing and naturally eutrophic; the Fergus being smaller and alkaline; while the narrow, fast-flowing Cloon is acid in nature. The Feale and Mulkear catchments exhibit all the aspects of a river from source to mouth. Seminal habitats, such as wet grassland, wet woodland and marsh occur by the rivers, however, improved grassland is most common. One grassland type of particular conservation significance, *Molinia* meadows, occurs in several parts of the site and the examples at Worldsend on the River Shannon are especially noteworthy. Here are found areas of wet meadow dominated by rushes and sedges and supporting a diverse and species-rich vegetation, including such uncommon species as Blue-eyed Grass (*Sisyrinchium bermudiana*) and Pale Sedge (*Carex pallescens*).

Floating river vegetation characterised by species of Water-crowfoot (*Ranunculus* spp.), Pondweeds (*Potamogeton* spp.) and the moss *Fontinalis antipyretica* are present throughout the major river systems within the site. The rivers contain an interesting bryoflora with *Schistidium alpicola* var. *alpicola* recorded from in-stream boulders on the Bilboa, new to county Limerick.

Alluvial woodland occurs on the banks of the Shannon and on islands in the vicinity of the University of Limerick. The woodland is up to 25m wide on the banks and somewhat wider on the largest island. The most prominent woodland type is gallery woodland where White Willow (*Salix alba*) dominates the tree layer with occasional Alder (*Alnus glutinosa*). The shrub layer consists of various willow species with sally (*Salix cinerea* ssp. *oleifolia*) and what appear to be hybrids of *S. alba* x *S. viminalis*. The herbaceous layer consists of tall perennial herbs. A fringe of Bulrush (*Typha* sp.) occurs on the riverside of the woodland. On slightly higher ground above the wet woodland and on the raised embankment remnants of mixed oak-ash-alder woodland occur. These are poorly developed and contain numerous exotic species but locally there are signs that it is invading open grassland. Alder is the principal tree species with occasional Oak (*Quercus robur*), Elm (*Ulmus glabra*, *U. procera*), Hazel (*Corylus avellana*), Hawthorn (*Crataegus monogyna*) and the shrubs Guelder-rose (*Viburnum opulus*) and willows. The ground flora is species-rich.

Woodland is infrequent within the site; however Cahiracon Wood contains a strip of old Oak woodland. Sessile Oak (*Quercus petraea*) forms the canopy, with an understorey of Hazel and Holly (*Ilex aquifolium*). Great Wood-rush (*Luzula sylvatica*) dominates the ground flora. Less common species present include Great Horsetail (*Equisetum telmateia*) and Pendulous Sedge (*Carex pendula*).



In the low hills to the south of the Slievefelim Mountains, the Cahernahallia River cuts a valley through the Upper Silurian rocks. For approximately 2km south of Cappagh Bridge at Knockanavar, the valley sides are wooded. The woodland consists of Birch (*Betula* spp.), Hazel, Oak, Rowan (*Sorbus aucuparia*), some Ash (*Fraxinus excelsior*) and Willow (*Salix* spp.). Most of the valley is not grazed by stock, and as a result the trees are regenerating well. The ground flora feature prominent Greater wood-rush and Bilberry (*Vaccinium myrtillus*) with a typical range of woodland herbs. Where there is more light available, Bracken (*Pteridium aquilinum*) features.

The valley sides of the Bilboa and Gortnageragh Rivers, on higher ground north east of Cappamore, support patches of semi-natural broadleaf woodland dominated by Ash, Hazel, Oak and Birch. There is a good scrub layer with Hawthorn, Willow, Holly and Blackthorn (*Prunus spinosa*) common. The herb layer in these woodlands is often open with a typically rich mixture of woodland herbs and ferns. Moss species diversity is high. The woodlands are ungrazed. The hazel is actively coppiced in places.

There is a small area of actively regenerating cut away raised bog at Ballyrorheen. It is situated approx. 5km north west of Cappamore Co. Limerick. The bog contains some wet areas with good moss (*Sphagnum*) cover. Species of particular interest include the Cranberry (*Vaccinium oxycoccos*) and the White Sedge (*Carex curta*) along with two other regionally rare mosses including *S. fimbriatum*. The site is being invaded by Birch (*Betula pubescens*) scrub woodland. Both commercial forestry and the spread of rhododendron has greatly reduced the overall value of the site.

A number of plant species that are Irish Red Data Book species occur within the site; several are protected under the Flora (Protection) Order, 1999:

- Triangular Club-rush (*Scirpus triquetrus*) - in Ireland this protected species is only found in the Shannon Estuary, where it borders creeks in the inner estuary.
- Opposite-leaved Pondweed (*Groenlandia densa*) - this protected pondweed is found in the Shannon where it passes through Limerick City.
- Meadow Barley (*Hordeum secalinum*) - this protected species is abundant in saltmarshes at Ringmoylan and Mantlehill.
- Hairy Violet (*Viola hirta*) - this protected violet occurs in the Askeaton/Foynes area.
- Golden Dock (*Rumex maritimus*) - noted as occurring in the River Fergus Estuary.
- Bearded Stonewort (*Chara canescens*) - a brackish water specialist found in Shannon Airport lagoon.
- Convergent Stonewort (*Chara connivens*) - presence in Shannon Airport Lagoon to be confirmed.

Overall, the Shannon and Fergus Estuaries support the largest numbers of wintering waterfowl in Ireland. The highest count in 1995-96 was 51,423 while in 1994-95 it was 62,701. Species listed on Annex I of the E.U. Birds Directive which contributed to these totals include: Great Northern Diver (3; 1994/95), Whooper Swan (201; 1995/96), Pale-bellied Brent Goose (246; 1995/96), Golden Plover (11,067; 1994/95) and Bar-tailed Godwit (476; 1995/96). In the past, three separate flocks of Greenland White-fronted Goose were regularly found but none were seen in 1993/94. Other wintering waders and wildfowl present include Greylag Goose (216; 1995/96), Shelduck (1,060; 1995/96), Wigeon (5,976; 1995/96); Teal (2,319; 1995-96); Mallard (528; 1995/96), Pintail (45; 1995/96), Shoveler (84; 1995/96), Tufted Duck (272; 1995/96), Scaup (121; 1995/96), Ringed Plover (240; 1995/96), Grey Plover (750; 1995/96), Lapwing (24,581; 1995/96), Knot (800; 1995/96), Dunlin (20,100; 1995/96), Snipe (719; 1995/96), Black-tailed Godwit (1062; 1995/96), Curlew (1504; 1995/96), Redshank (3228; 1995/96), Greenshank (36; 1995/96) and Turnstone (107; 1995/96). A number of wintering gulls are also present,



including Black-headed Gull (2,216; 1995/96), Common Gull (366; 1995/96) and Lesser Black-backed Gull (100; 1994/95).

This is the most important coastal site in Ireland for a number of the waders including Lapwing, Dunlin, Snipe and Redshank. It also provides an important staging ground for species such as Black-tailed Godwit and Greenshank.

A number of species listed on Annex I of the E.U. Birds Directive breed within the site. These include Peregrine Falcon (2-3 pairs), Sandwich Tern (34 pairs on Rat Island, 1995), Common Tern (15 pairs: 2 on Sturamus Island and 13 on Rat Island, 1995), Chough (14-41 pairs, 1992) and Kingfisher. Other breeding birds of note include Kittiwake (690 pairs at Loop Head, 1987) and Guillemot (4010 individuals at Loop Head, 1987)

There is a resident population of Bottle-nosed Dolphin in the Shannon Estuary consisting of at least 56-68 animals (1996). This is the only known resident population of this E.U. Habitats Directive Annex II species in Ireland. Otter, a species also listed on Annex II of this directive, is commonly found on the site.

Five species of fish listed on Annex II of the E.U. Habitats Directive are found within the site. These are Sea Lamprey (*Petromyzon marinus*), Brook Lamprey (*Lampetra planeri*), River Lamprey (*Lampetra fluviatilis*), Twaite Shad (*Allosa fallax fallax*) and Salmon (*Salmo salar*). The three lampreys and Salmon have all been observed spawning in the lower Shannon or its tributaries. The Fergus is important in its lower reaches for spring salmon while the Mulkear catchment excels as a grilse fishery though spring fish are caught on the actual Mulkear River. The Feale is important for both types. Twaite Shad is not thought to spawn within the site. There are few other river systems in Ireland which contain all three species of Lamprey.

Two additional fish of note, listed in the Irish Red Data Book also occur, namely Smelt (*Osmerus eperlanus*) and Pollan (*Coregonus autumnalis pollan*). Only the former has been observed spawning in the Shannon.

Freshwater Pearl-mussel (*Margaritifera margaritifera*), a species listed on Annex II of the E.U. Habitats Directive, occurs abundantly in parts of the Cloon River.

There is a wide range of land uses within the site. The most common use of the terrestrial parts is grazing by cattle and some areas have been damaged through overgrazing and poaching. Much of the land adjacent to the rivers and estuaries has been improved or reclaimed and is protected by embankments (especially along the Fergus Estuary). Further, reclamation continues to pose a threat as do flood relief works (e.g. dredging of rivers). Gravel extraction poses a major threat on the Feale.

In the past, Cord-grass (*Spartina* sp.) was planted to assist in land reclamation. This has spread widely, and may oust less vigorous colonisers of mud and may also reduce the area of mudflat available to feeding birds.

Domestic and industrial wastes are discharged into the Shannon, but water quality is generally satisfactory - except in the upper estuary, reflecting the sewage load from Limerick City. Analyses for trace metals suggest a relatively clean estuary with no influences by industrial discharges apparent. Further industrial development along the Shannon and water polluting operations are potential threats.



Fishing is a main tourist attraction on the Shannon and there are a large number of Angler Associations, some with a number of beats. Fishing stands and styles have been erected in places. The River Feale is a designated Salmonid Water under the E.U. Freshwater Fish Directive. Other uses of the site include commercial angling, oyster farming, boating (including dolphin-watching trips) and shooting. Some of these may pose threats to the birds and dolphins through disturbance. Specific threats to the dolphins include underwater acoustic disturbance, entanglement in fishing gear and collisions with fast moving craft.

This site is of great ecological interest as it contains a high number of habitats and species listed on Annexes I and II of the E.U. Habitats Directive, including the priority habitat lagoon, the only known resident population of Bottle-nosed Dolphin in Ireland and all three Irish lamprey species. A good number of Red Data Book species are also present, perhaps most notably the thriving populations of Triangular Club-rush. A number of species listed on Annex I of the E.U. Birds Directive are also present, either wintering or breeding. Indeed, the Shannon and Fergus Estuaries form the largest estuarine complex in Ireland and support more wintering wildfowl and waders than any other site in the country. Most of the estuarine part of the site has been designated a Special Protection Area (SPA), under the E.U. Birds Directive, primarily to protect the large numbers of migratory birds present in winter.



APPENDIX 2 DEVELOPMENT APPLICATIONS UNIT LETTER



An Roinn Turasóireachta, Cultúir,
Ealaíon, Gaeltachta, Spóirt agus Meán
Department of Tourism, Culture,
Arts, Gaeltacht, Sport and Media

Your Ref: 201156 LCCC 2021
Our Ref: G Pre00015/2021 (Please quote in all related correspondence)

15th March 2021

Michael O'Sullivan
Punch Consulting
97 Henry Street
Limerick
V94 YC2H

Via email: mosullivan@punchconsulting.com

Re: Re: Notification to the Minister for Culture, Heritage and the Gaeltacht under the Planning and Development Act, 2000, as amended.

Re: early notification that Limerick City and County Council (LCCC) intend to carry out rehabilitation works on 11 Bridges in Limerick County in 2021

A chara

I refer to correspondence dated 21st January received in connection with the above. Outlined below are heritage-related observations/recommendations co-ordinated by the Development Applications Unit under the stated headings.

Nature Conservation

Please find below some general scoping comments for appropriate assessment screening, appropriate assessment/NIS, and for licensing requirements specific to bridge works which may assist. Please note that, should the project screen out for AA; that the comments apply to any ecological impact assessment (EclA) or similar ecological report to be produced.

Alien invasive species

The assessment should address the issue of invasive alien plant and animal species, such as Japanese Knotweed, and detail the methods required to ensure they are not accidentally introduced or spread during construction. Information on alien invasive species in Ireland can be found at <http://invasives.biodiversityireland.ie/> and at <http://invasivespeciesireland.com/>.

Aonad na nIarratas ar Fhorbairt

Development Applications Unit

Oifigi an Rialtais

Government Offices

Bóthar an Bhaile Nua, Loch Garman, Contae Loch Garman, Y35 AP90

Newtown Road, Wexford, County Wexford, Y35 AP90



Crayfish Plague is now present in several Irish rivers including some in Limerick, therefore it is essential that any equipment used which has the potential to carry the disease is disinfected and dried before use, pumps or other equipment that may hold water residues are particularly dangerous in this respect. Care must also be taken leaving the site that spores of the disease are not transported to any other site. All employees should also be briefed on the risk of disease transfer from and to other sites.

Bats

Bat roosts may be present in trees, buildings and bridges. Bat roosts can only be destroyed under licence under the Wildlife Acts and a derogation under the Birds and Natural Habitats Regulations and such a licence would only be given if suitable mitigation measures were implemented. Where so called bat friendly lighting is proposed as mitigation then it should be proven to work as mitigation. However please note that the recently published *Bats and Artificial Lighting in the UK, Guidance Note 08/18, Bat Conservation Trust and Institution of Lighting Professionals*, which can be downloaded from <https://www.theilp.org.uk/documents/guidance-note-8-bats-and-artificial-lighting/>, has found that artificial lighting has been found to be particularly harmful if used along river corridors, near woodland edges and near hedgerows. Therefore lighting in woodlands and ecological corridors should be avoided. The Local Authority should also consult the Eurobats Publication Series No. 8, Guidelines for consideration of bats in lighting projects, which can be downloaded from http://www.eurobats.org/publications/eurobats_publication_series

Rivers and Wetlands

Wetlands are important areas for biodiversity. Any watercourse or wetland impacted on should be surveyed for the presence of protected species and species listed on Annexes II and IV of the Habitats Directive. These species could include otters (*Lutra lutra*), which are protected under the Wildlife Acts and listed on Annexes II and IV of the Habitats Directive, Salmon (*Salmo salar*) and Lamprey species listed on Annex II of the Habitats Directive, Freshwater Pearl Mussels (*Margaritifera species*) and White-clawed Crayfish (*Austropotamobius pallipes*) which are protected under the Wildlife Acts and listed on Annex II of the Habitats Directive, Frogs (*Rana temporaria*) and Newts (*Trituris vulgaris*) protected under the Wildlife Acts and Kingfishers (*Alcedo atthis*) protected under the Wildlife Acts and listed on Annex I of the Birds Directive (Council Directive 79/409 EEC).

One of the main threats identified in the threat response plan for otter is habitat destruction (see www.npws.ie/sites/default/files/publications/pdf/2009_Otter_TRP.pdf).

In addition a 15m riparian buffer on both banks of a waterway is considered to comprise part of the otter habitat. Therefore any proposed development should be located at least 15 m away from the waterway.



A suitable riparian habitat should be left along each watercourse. Construction work should not be allowed impact on water quality and measures should be detailed in the assessment to prevent sediment and/or fuel runoff from getting into watercourses which could adversely impact on aquatic species.

IFI should be consulted with regard to impacts on fish species and the applicant may find it useful to consult their publication entitled "Planning for watercourses in the urban environment" which can be downloaded from their web site at <http://www.fisheriesireland.ie/fisheries-management-1/86-planning-for-watercourses-in-the-urban-environment-1/file>.

Bridges and Flora

Masonry bridges are a valuable habitat for a myriad of saxicolous vascular, bryophyte and lichen species. Many species have as their preferred habitat such structures whilst a smaller, restricted number of rarer species are dependant solely on such structures (usually on the mortar between the masonry). There is a very good chance that cleaning the mosses off bridges and walls could have a real impact on Irish biodiversity. The recommendations below are made in the interests of maintaining this aspect of Ireland's biodiversity (recently highlighted in the publication of 'The Rare and Threatened Bryophytes of Ireland'.

Only lime mortar should be used for repointing, grouting etc. (as per NRA guidelines as stated)

The "Removal of vegetation from the bridge surface, parapets and embankments", should be carried out judiciously so as to avoid the wholesale removal of small vascular plants, bryophytes and lichens – their removal should be deemed only necessary for imperatives reasons of engineering integrity.

Note: however that a bat survey should be carried out before any pointing or grouting.

Licences

Where there are impacts on protected species and their habitats, resting or breeding places, licenses may be required under the Wildlife Acts or derogations under the Habitats Regulations. In particular bats and otters and cetaceans are strictly protected under annex IV of the Habitats Directive. A copy of Circular Letter NPWS 2/07 entitled "Guidance on Compliance with Regulation 23 of the Habitats Regulations 1997 – strict protection of certain species/applications for derogation licences" can be found on the Departmental web site at www.npws.ie/sites/default/files/general/circular-npws-02-07.pdf. It should be noted however that the Regulations of 1997 have since been revoked and that Part 6 of the European Communities (Birds and Natural Habitats) Regulations 2011-2015 is now the relevant part



dealing with the protection of flora and fauna. In particular reference to Regulation 23 in the circular letter should be taken to mean Regulation 51 in the current Regulations.

In addition the applicant and the planning authority will be required to take account of species protected under sections 21, 22 and 23 of the Wildlife Acts if there are any impacts on other protected species or their resting or breeding places, such as on protected plants, or birds' nests. They will also need to be cognisant of article 5 (d) of the Birds Directive. For that reason vegetation, including hedges and trees, should not be removed during the nesting season (i.e. March 1st to August 31st).

In order to apply for any such derogations as mentioned above the results of a survey should be submitted to the National Parks and Wildlife Service of this Department. Such surveys are to be carried out by appropriately qualified person/s at an appropriate time of the year. Details of survey methodology should also be provided.

Underwater Archaeology

It is recommended that an Underwater Archaeological Impact Assessment, as described below, shall be undertaken to assess the impact on known or potential archaeology in the area of the proposed works.

Underwater Archaeological Impact Assessment should be compiled as follows:

1. The applicant is required to engage the services of a suitably qualified archaeologist to carry out an underwater archaeological assessment - to include an assessment of the river banks within the area of the proposed development. All of the surveys shall be undertaken to the specifications advised by the Department of Housing, Local Government & Heritage.
2. The archaeologist should carry out any relevant documentary research and inspect the site and undertaken a dive survey with metal detection.
3. The archaeologist should be licensed under the National Monuments Acts 1930-2004. Diving operations should be undertaken to the Health and Safety Authority's Rule under the Health and Safety at Work (Diving Operations) Regulations 1981 SI 422. and to include that the proper qualifications are held by the dive team and the proper commercial dive insurance is in place
4. Having completed the work, the archaeologist shall submit a written report to the Department of Housing, Local Government & Heritage. Where archaeological material/features are shown to be present, preservation *in situ*, preservation by record (excavation), avoidance or monitoring may be required. This Department shall advise should such matters arise.

.....
4



5. No decision shall be made until this Department has had the opportunity to evaluate the Archaeological Assessment. This Department will forward a recommendation based on the Archaeological Assessment to the Local Authority.

You are requested to send further communications to the Development Applications Unit (DAU) at manager.dau@chq.gov.ie, or to the following address:

The Manager
Development Applications Unit (DAU)
Government Offices
Newtown Road
Wexford
Y35 AP90

Is mise, le meas

Diarmuid Buttiner
Development Applications Unit